

90°

HiCAD Plant Engineering

Version 2021

Creating new parts and variants

Date of issue: 20/10/2021



TOC

Creating New Parts and Variants.	5
Using Connection Type Attributes.	7
General information	7
Connection type ID with priority information.	8
Connection type ID - List of part standards	8
List of Part Type IDs.	§
Part type IDs in Plant Engineering.	
Part type IDs for Air ducts	6
Creating Individual Parts: Procedure	11
Rules for the Creation of User-Defined Parts.	13
Part Type: Branch	14
Part Type: Valve	17
Part Type: Blank Flange	20
Part Type: Double Knee	22
Part Type: 3-Way Valve.	2 4
Part Type: Corner Valve.	27
Part Type: Flange.	30
Part Type: Straight Pipe	32
Part Type: Y-Piece	35
Part Type: Cap.	38
Part Type: Knee	40
Part Type: Cross	42
Part Type: Gauge part	45
Part Type: Reducer, Concentric	47
Part Type: Reducer, Excentric	49
Part Type: Elbow	51
Part Type: Pipe Clamp	53
Part Type: Vessels, Pumps, Other components	55
Part Type: Nozzle	56
Part Type: Other Pipe Part	58
Part Type: T-Piece.	
Part Type: 4-Way Valve.	64
Part Type: Seal	
Pressure ranges.	68

Part Type: Saddle Connection / Elbolet	7 1
Rules for the Creation of User-Defined Feature Variants.	75
Variant for Part Type: Branch.	76
Variant for Part Type: Valve	79
Variant for Part Type: Blank Flange	82
Variant for Part Type: Double Knee.	84
Variant for Part Type: 3-Way Valve.	87
Variant for Part Type: Corner Valve.	90
Variant for Part Type: Flange	93
Model welding necks as flanges.	95
Variant for Part Type: Straight Pipe.	
Model collar pieces as straight pipes.	
Variant for Part Type: Y-Piece.	
Variant for Part Type: Cap.	105
Variant for Part Type: Knee	108
Variant for Part Type: Cross.	
Variant for Part Type: Gauge part.	115
Variant for Part Type: Reducer, Excentric.	119
Variant for Part Type: Reducer, Concentric.	122
Variant for Part Type: Elbow.	125
Variant for Part Type: Pipe Clamp.	128
Variant for Part Type: Vessels, Pumps, Other Components.	130
Variant for Part Type: Nozzle.	132
Variant for Part Type: Other Pipe Parts	135
Variant for Part Type: T-Piece	140
Variant for Part Type: 4-Way Valve.	144
Variant for Part Type: Seal.	147
Pressure ranges.	148
Variant for Part Type: Fastener	150
Variant fpr Part Type: Saddle Connection / Elbolet	152
Rules for the Creation of Symbolic Representations.	155

Creating New Parts and Variants

Besides using the part and variants which have been predefined by the ISD you can also create,

- new Plant Engineering parts and
- new Feature Variants for Plant Engineering parts.

Please note that for the creation of new parts and new variants certain rules, depending on the particular part type, need to be respected.


IMPORTANT - Please note the following when working with user-defined variants for flanges or parts with flanges:

You can use the **Flange connection, bolted** functions of the Plant Engineering module to place boltings on flange connections. To ensure that the boltings match the flanges, the functions will evaluate the variables of the part variant to which the flange belongs. This also needs to be considered if construct your own parts/variants with flange connections, because otherwise, problems will occur during their processing with the flange connection functions.

The following table shows the lists of variables. The <u>second</u> place of the variable's designation must match the connection number. The list here refers to the example of the first connection of a part.

- B1 Thickness of flange plate (B1 = C1 + F1)
- C1 Thickness of flange plate (without collar)
- F1 Thickness of collar
- A1 Number of bolts
- K1 Diameter of bore circle
- D12 Bore diameter
- L Part length (not connection-specific)

Hence, the variables of the second connection will have the designations B2, C2, F2, A2, D22.

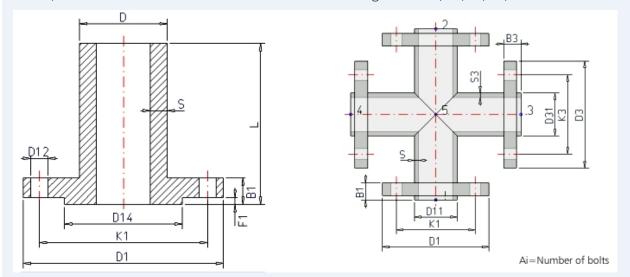

HiCAD Plant Engineering 5 / 158

Additional, part-specific rules apply during evaluation:

- 1. If the variables C1 and F1 are defined in a loose flange, the grip length of the bolting will be determined via the value C1+F1 istead of using B1.
- 2. For blank flanges the variable L instead of B1 will be used for grip length determination provided that L has been defined.

The value of the variables NI (capital "N", capital "i", NO "1"!) is used as an additional attribute during creation or querying of an article master in HELiOS. It represents the nominal diameter in Inches

Using Connection Type Attributes

General information

In the data records of parts, the attributes

- Anschlussart (=Connection type),
- Anschlussart2 and
- Anschlussart3

enable a determination of the type of connection and of any required accessories. If a part to which particular connecting parts have been assigned via connection attributes is placed onto a guideline, the accessories will be automatically attached to connections 1 and 2 of the part.

If no own attribute entry exists for a connection, the entry with the next lower connection number will be used.

Example:

If we assume that entries only exist for **Anschlussart** (Connection type) and **Anschlussart3** (Connection type 3) respectively, then the attribute for **Anschluss** (Connection) also applies to connection 2.

The attribute entry is composed of an ID number (connection type ID) and a supplement.

ID	Meaning	ID	Meaning
1000x	welded	3200x	screwed, f
2000x	flange	4100x	plugged, m
2100x	flange with notch	4200x	plugged, f
2200x	flange with groove	5100x	butt-welded, m
3100x	screwed, m	5200x	butt-welded, f

The last digit (x) of the identification number provides additional information on the supplement:

- 0 no supplement
- 2 The supplement is composed of the connection number, part type ID and part standard of the part to be attached.

Example:

20002 1 5100010 DIN 2633

This means: "Attach flange according to DIN 2633 with Connection 1."

The wildcard character ('?') is not allowed for the part type ID (in this case 5100010).

The 4th digit of the ID is interpreted as a priority indicator. This digit is important in cases where two parts coincide on one connection which both specify additional parts to be inserted via their connection type (often Fasteners). If one part is connected to another part, on the connecting points of which fasteners are already located, the prioritization will be evaluated.

The meaning of the 3rd digit has not been defined yet.

HiCAD Plant Engineering 7 / 158



Please note:

- Parts with only one "genuine" connection still require two named isolated points (Designation: ! and 2) to enable them to be auto-aligned correctly. To prevent Point 2 from being falsely interpreted as a connection in the isometry, the attribute ANSCHLUSSART2 needs to be set to the value 0.
- If no entry concerning the "Anschlussart" ("Connection type") attribute exists for a part, HiCAD assumes 10000 (= welded, without supplement).

Connection type ID with priority information

In practice it can happen that two parts coincide which both specify additional parts to be inserted via their connection type (often Fasteners). In such cases, the last but one digit of the connection will be interpreted as a priority indicator. If one part is connected to another part, on the connecting points of which fasteners are already located, the prioritization will be evaluated. If the part to be connected has a higher priority, the fasteners that already exist on the connection will be removed and replaced with the part to be connected.

If the connection type of the part to be connected has a lower priority, its fasteners will not be inserted.

In cases of equal priority new fasteners will only be inserted if no fasteners exist on the connection yet.

The priority information will also be evaluated if a part does not supply any further elements. Even in such cases, existing fasteners will be removed if the part to be connected has a connection type with a higher priority than that of the existing connection. This means that a part can remove all fasteners because it acts as a fastener itself.

Connection type ID - List of part standards

Instead of specifying a standard in the supplement, it is also possible to specify a list of standards separated by commas, e.g.

41002 1 5971010 Standard_A, Standard_B, Standard_C

During part search in the catalogue or in the HELiOS database the standards will be combined by means of an OR condition. This means that not several parts are specified here, but the range of allowed parts will be extended here.



Important:

In the part standards list, spaces will be interpreted as allowed characters of a standard designation. Therefore, no additional spaces must be entered to the right and to the left of the separating commas. Since the standards are separated by commas, they must not contain any commas themselves.

List of Part Type IDs

In the data record of a part you can, with the help of the so-called connection type attributes, specify the connection types and the fasteners that may be required for this. If a part to which particular fasteners are assigned via connection attributes will be places on a guideline, these will be automatically placed onto the Connections 1 and 2 of the part.

For this the part type ID will be required.

Part type IDs in Plant Engineering

ID	Part type	ID	Part type
1000010	Straight pipe	5900010	Other pipe part
1010011	Nozzle	5910011	Double knee
2100010	Elbow	5920010	Gauge part
2200010	Knee	5970010	Fastener, symmetrical
3110010	T-piece	5971010	Fastener, asymmetrical
3210011	Y-piece	5980010	Weld gap
3230010	Branch	5990011	Sealing gasket
3300010	Cross	6110010	Saddle connection
4100010	Valve	6110010	Elbolet
4200010	Corner valve	9100001	Vessel
4300010	3-way valve	9110001	Pump
4400010	4-way valve	9700001	Other component
5100010	Flange	9800001	Gauge
5210010	Сар	9960001	Accessory set
5310010	Reducer, concentric	9960001	Bolted flange connection
5320011	Reducer, excentric	9970001	Insulation
5710010	Blank flange	9980001	Connection
5800010	Pipe clamp		

Part type IDs for Air ducts

ID	Part type	ID	Part type
1030010	Straight pipe (round)	5610030	Pipe transition, symmetrical (rectangular)
2210020	Elbow, symmetrical (rectangular)	5620031	Pipe transition, asymmetrical (rectangular)
2230020	Elbow transition (rectangular)	5510020	Transition, symmetrical (rectangular)

HiCAD Plant Engineering 9 / 158

ID	Part type	ID	Part type
2220020	Angle, symmetrical (rectangular)	5520021	Transition, asymmetrical (rectangular)
2240020	Angle, transition (rectangular)	5530021	Transition fitting (rectangular)
1020020	Duct part (rectangular)	3210021	Y-piece (rectangular)
5410021	Offset bend, symmetrical (rectangular)	3130021	T-piece, with offset (rectangular)
5420021	Offset transition (rectangular)	3120020	T-piece, without offset (rectangular)
5220020	Base (rectangular)	5902021	Other duct parts (rectangular)

Creating Individual Parts: Procedure

Besides Plant Engineering parts which are based on a variant and are generated via this variant, you can also create new, individual parts with fixed dimensions. If you want to construct a new, <u>non</u>- parameterised (fixed) Plant Engineering part for the available representation types, proceed as follows:

Please observe the Rules for the creation of the respective part type, as well as the Rules for the creation of symbolic representations.

With the HELiOS Database as part data source: (3 representation types are possible)

- 1. Construct a hollow body in HiCAD 3-D.
- 2. Save part as KRA file (without referencing, without part master and document master) to PlantParts\Parts2.
- 3. Check part with the Check part, Geometry Particular.
- 4. Construct a solid body in HiCAD 3-D.
- 5. Save part as KRA file (without referencing, without part master and document master) to *PlantParts\Parts3*, with the same name as the hollow body representation.
- 6. Check part with the Check part, Geometry Part function.
- 7. Load the new KRA file from *PlantParts\Parts3* with the **PAA-Editor** and modify it as desired (enter attribute values). Save the part, i.e. create a PAA file.
- 8. Activate the **Part data synchronisation** function to perform the part data synchronisation with the database.
- 9. Check the attribute data with the Check parts, Attributes function.
- 10. Create the symbolic representation with the **Symbol Editor** and add it to the new PAA file.

With the HiCAD Catalogue as part data source: (2 representation types are possible)

- 1. Construct a hollow body in HiCAD 3-D.
- 2. Save part as KRA file ("Save as part", without referencing) to PlantParts\Parts2.
- 3. Check part with the Check part, Geometry 🌇 function.
- Construct a solid body in HiCAD 3-D.
- 5. Save part as KRA file ("Save as part", without referencing) to *PlantParts\Parts3*, with the same name as the hollow body representation.
- 6. Check part with the **Check part, Geometry** function.
- 7. Load the new KRA file from *PlantParts\Parts3* with the **PAA-Editor** and modify it as desired (enter attribute values). Save the part, i.e. create a PAA file.

HiCAD Plant Engineering 11 / 158

8. Activate the **Part data synchronisation** function to perform the part data synchronisation (this function calls the **VarToCat** tool).

If you want to initially create only one representation type for a Plant Engineering part in order to check whether the part functions in the way you expect it, you can omit three steps in the procedures described above:

- If you initially only require the solid body representation, omit the steps 1 3.
- If you initially only require the hollow body representation, omit the steps 4 6. Continue with step 7 to load the KRA file from *PlantParts\Parts2*.

If you want to add another representation type later (here: hollow body), the following steps are required:

- 1. Construct a hollow body in HiCAD 3-D.
- 2. Save part as KRA file ("Save as part", without referencing) to *PlantParts\Parts2* with a different name than the other representation type.
- 3. Check part with the Check part, Geometry 🎉 function
- 4. Load the new KRA file from *PlantParts\Parts2* with the **PAA-Editor**. Do not modify it, but save it immediately, i.e. create a PAA file. (If you have created the solid body representation instead of the hollow body representation, load the new KRA file from *PlantParts\Parts3*).
- 5. Now load the PAA file of the representation type that you have first created and tested (here: Solid body) from *PlantParts* with the **PAA Editor**. Use the **Edit archive** option to add the second representation type (here: Hollow body) from the corresponding PAA file. In the PAA Editor, save the still open PAA file of the first representation type, whereupon it will contain both representation types. The PAA file of the second representation type is now no longer needed.

Another part data synchronisation will not be required if you have only added the second representation type.

Rules for the Creation of User-Defined Parts


Besides Plant Engineering parts which are based on and created via a variant, you can also create new, individual parts with fixed dimensions. These parts are .PAA files. For their creation certain rules, depending on the particular part type, need to be respected.

When using your own variants for flanges or parts with flanges, please read the notes on bolted flange connections!

- Part type: Branch
- Part type: Valve
- Part type: Blank flange
- Part type: Double knee
- Part type: 3-way valve
- Part type: Corner valve
- Part type: Flange
- Part type: Straight pipe
- Part type: Y-piece
- Part type: Cap
- Part type: Knee
- Part type: Cross
- Part type: Gauge part
- Part type: Reducer, concentric
- Part type: Reducer, excentric
- Part type: Elbow
- Part type: Pipe clamp
- Part type: Vessels, Pumps, Other components
- Part type: Nozzles
- Part type: Other pipe part
- Part type: T-piece
- Part type: 4-way valve
- Part type: Seal
- Part type: Fasteners
- Part type: Saddle connection / Elbolet

HiCAD Plant Engineering 13 / 158

Part Type: Branch

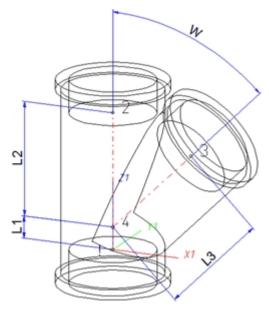

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0
4	Auxiliary point	Branching point of centre line	X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
WINKEL	Angle (see angle in drawing)
NENNWEITE	Nominal diameter, Connection"!"
NENNWEITE2	Nominal diameter, Connection "2"
NENNWEITE3	Nominal diameter, Connection "3"
Additionally (only if the correspondi	ng standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!"
NPS2_INCH	Nominal diameter (inches), Connection "2"
NPS3_INCH	Nominal diameter (inches), Connection "3"
These parameters are to be considencting sockets they refer to the pip	ered for all connection types except for flange connections. For cone to be inserted:
D_AUSSEN	Outer diameter, Connection "!"
D2_AUSSEN	Outer diameter, Connection "2"
D3_AUSSEN	Outer diameter, Connection "3"
WANDDICKE	Wall thickness, Connection "!"
WANDDICKE2	Wall thickness, Connection "2"
WANDDICKE3	Wall thickness, Connection "3"
ANSCHLUSSART	Connection type , Connection "!"
ANSCHLUSSART2	Connection type, Connection "2"
ANSCHLUSSART3	Connection type, Connection "3"

HiCAD Plant Engineering 15 / 158

Attribute		Description			
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):					
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				


The last character (x) provides information about the meaning of the supplement:

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected
The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Valve

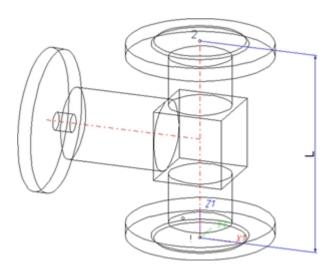

The centre axis of the actuator should be located in the plane X < 0, Y = 0, Z > 0!

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	

HiCAD Plant Engineering 17 / 158

Attribute		Description	
NENNWEITE		Nominal diameter, Connection "!" and "2"	
Additiona	illy (only if the corresponding	g standard uses nominal diameters in inches):	
NPS_INC	Н	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"	
-	rameters are to be considere ockets they refer to the pipe	ed for all connection types except for flange connections. For conto be inserted:	
D_AUSSE	N	Outer diameter, Connection "!" and "2"	
WANDDI	CKE	Wall thickness, Connection "!" and "2"	
ANSCHLU	JSSART	Connection type	
Possible v	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):	
1000x	Butt-welded	Provide auxiliary part when fitting part	
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-	
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of	
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40 EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own part master attached to this connection.		
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4200x	Plugged, socket		
5100x	Socket-welded, nipple		

The last character (x) provides information about the meaning of the supplement:


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Connection types: Examples

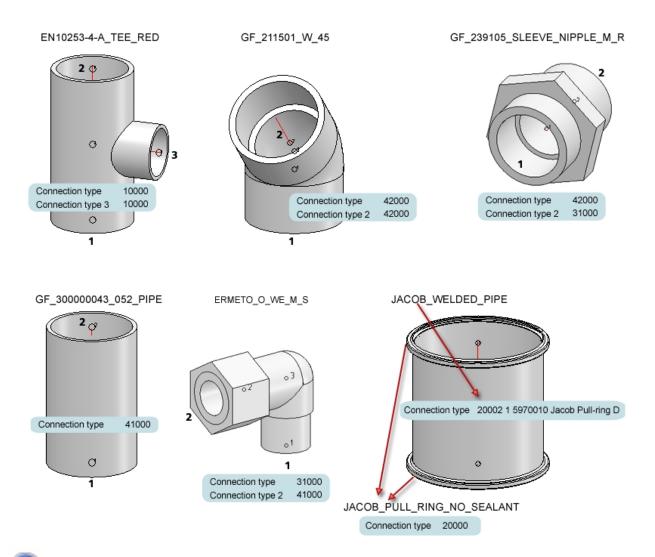

Parts with socket-welded connections (51000 / 52000) are currently not contained in the HiCAD part inventory.

HiCAD Plant Engineering 19 / 158

Part Type: Blank Flange

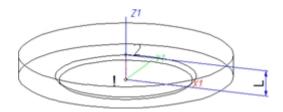

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!"
Additionally (only if the corresponding sta	andard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection "!"
ANSCHLUSSART	Connection type for Connection "!" (always flange connection)

Attribute		Description			
Possible va	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):				
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the			
2100x	Flange with groove connection	part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange			
2200x	Flange with notch connection	connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40 EN 1092-1/11/A/PN 40 is the standard designation			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple	with which the flange is to be entered into the database.			
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 21 / 158

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Part Type: Double Knee

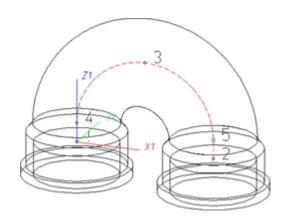

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (X1=0,Y1=0,Z1=0)
2	Connecting point		X2 > 0, $Y2 = 0$, $Z2 = 0$
3	Auxiliary point		X3 = X2/2, Y3 = 0, Z3 > Z4
4	Auxiliary point		X4 = 0, Y4 = 0, Z4 > 0
5	Auxiliary point		X5 = X2, Y5 = 0, Z5 = Z4

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!" and "2"
Additionally (only if the correspond	ding standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"
These parameters are to be considered necting sockets they refer to the p	dered for all connection types except for flange connections. For conipe to be inserted:
D_AUSSEN	Outer diameter, Connection "!" and "2"

Attribute	Description
WANDDICKE	Wall thickness, Connection "!" and "2"
ANSCHLUSSART	Connection type , Connection "!"
ANSCHLUSSART2	Connection type, Connection "2"
Possible values of the attribute ANSCHILLSSART (CONNECTION TYPE).	

٢	ossible va	nues of the attribute ANSCHL	USSART (CONNECTION_TYPE)
	1000x	Butt-welded	Provide auxiliary part when fitting part
	2000x	Flange connection	If appropriately preset in the ANSCHLU a connection, the part will provide and connection.
	2100x	Flange with groove connection	cified in the attribute for the connection of a flange connection and the correspond
	2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION) 20002 1 5100010 EN 1092-1/11/A/PI
	2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standa entered into the database.
	3100x	Screwed, nipple	
	3200x	Screwed, socket	
	4100x	Plugged, nipple	
	4200x	Plugged, socket	
	5100x	Socket-welded, nipple	
	5200x	Socket-welded, socket	

USSART (CONNECTION_TYPE) attribute for connect an auxiliary part of the standard spewhen being fitted. For example, if the part has ding counter-flange is required, the content of I_TYPE) attribute could look as follows:

N 40

ard designation with which the flange is to be

The last character (x) provides information about the meaning of the supplement:

0=No supplement


2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 23 / 158

Part Type: 3-Way Valve

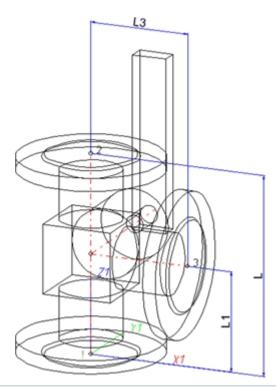

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter, Connection "!" and "2"	
NENNWEITE3	Nominal diameter, Connection "3"	
Additionally (only if the corresponding star	ndard uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"	
NPS3_INCH	Nominal diameter (inches), Connection "3"	
These parameters are to be considered fo necting sockets they refer to the pipe to be	r all connection types except for flange connections. For cone inserted:	
D_AUSSEN	Outer diameter, Connection "!" and "2"	
D3_AUSSEN	Outer diameter, Connection "3"	
WANDDICKE	Wall thickness, Connection"!" und "2"	
WANDDICKE3	Wall thickness, Connection"3"	
ANSCHLUSSART	Connection type, Connection "!", "2" and "3"	

HiCAD Plant Engineering 25 / 158

Attribute		Description				
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):						
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for				
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe- cified in the attribute for the connection when being fitted. For example, if the part has				
2100x	Flange with groove connection	a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40				
2200x	Flange with notch connection					
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.				
3100x	Screwed, nipple					
3200x	Screwed, socket					
4100x	Plugged, nipple					
4200x	Plugged, socket					
5100x	Socket-welded, nipple					
5200x	Socket-welded, socket					


The last character (x) provides information about the meaning of the supplement:

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected
The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Corner Valve

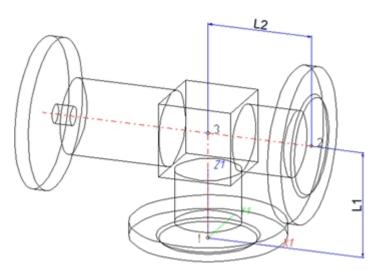

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Corner point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 27 / 158

Attribute		Description	
NENNWE	TITE	Nominal diameter, Connection "!"	
NENNWE		Nominal diameter, Connection "2"	
INLININVVL	-11 LZ	Normal dameter, connection 2	
Additiona	ally (only if the corresponding	standard uses nominal diameters in inches):	
NPS_INCH		Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection"!"	
NPS2_IN	CH	Nominal diameter (inches), Connection "2"	
-	ockets they refer to the pipe	ed for all connection types except for flange connections. For conto be inserted: Outer diameter, Connection "!"	
D2 AUSS		Outer diameter, Connection "2"	
WANDDI		Wall thickness, Connection "!"	
WANDDI		Wall thickness, Connection "2"	
**/ ((1 1 1 1 1 1 1 1	OI \LL	wan unowness, connection 2	
ANSCHL	JSSART	Connection type, Connection "!" and "2"	
Possible v	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):.	
1000x	Butt-welded	Provide auxiliary part when fitting part	
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has	
2100x	Flange with groove connection	a flange connection and the corresponding counter-flange is required, the content of	
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to lentered into the database.	
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4100X			
4200x	Plugged, socket		
	Plugged, socket Socket-welded, nipple		

The last character (x) provides information about the meaning of the supplement:

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement


 $[\]mathbf{2}$ = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

When using the HELiOS database, please make sure that you use the correct Classification matching the part type!

HiCAD Plant Engineering 29 / 158

Part Type: Flange

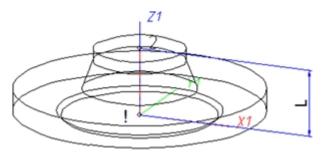

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter, Connection "!" and "2"	
Additionally (only if the corresponding standard uses nominal diameters in inches):		
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "chacters), Connection"!" and "2"	

Attribute	Description		
D_AUSSEN	Outer diameter, Connection "2"		
WANDDICKE	Wall thickness, Connection "2"		
ANSCHLUSSART	Connection type, Connection"!" (always flange connection)		
ANSCHLUSSART2	Connection type, Connection"2"		
D. THE RESIDENCE OF THE PROPERTY OF THE PROPER			

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1 0001010 1	alacs of the attribe	ate ///voorteedo//// (convictorion_file).			
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the			
2100x	Flange with groove connection	connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION TYPE) attribute could look as follows:			
2200x	Flange with notch connection	20002 1 5100010 EN 1092-1/11/A/PN 40 EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
2010x	Flange connection of a loose flange				
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket- welded, nipple				
5200x	Socket- welded, socket				
The last char	cactor (v) provides infor	mation about the meaning of the supplement.			

The last character (x) provides information about the meaning of the supplement:

0=No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected


The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Loose flanges are assigned to the part type Flange. The attribute ANSCHLUSSART (=CONNECTION_TYPE), however, must have the value 20100!

HiCAD Plant Engineering 31 / 158

Part Type: Straight Pipe

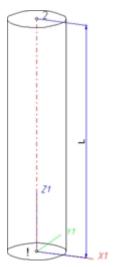

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Designation
BENENNUNG	Designation of part
NORMBEZEICHNUNG Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.	
BELIEBIG_TEILBAR	Indicates whether a cutting to length of the pipe is permissible

Attribute	Designation	
LIEFERLAENGE	Supplied length in m (!)	
NENNWEITE	Nominal diameter, Connection "!" and "2"	
Additionally (only if the	e corresponding standard uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection"!" and "2"	
	to be considered for all connection types except for flange connections. For conefer to the pipe to be inserted:	
D_AUSSEN	Outer diameter, Connection"!" and "2"	
WANDDICKE	Wall thickness, Connection"!" and "2"	
ANSCHLUSSART	Connection type, Connection"!" (and "2") If you want both pipe ends to have the same connection type it will suffice to spe-	
ANSCHLUSSART2	cify a value for the ANSCHLUSSART attribute. If you want the two pipe ends to have different connection types, the connection type for Connection 1 must be specified for the ANSCHLUSSART attribute, and the connection type for Connection 2 for the ANSCHLUSSART2 attribute.	
	If you want to create a new feature variant of a straight pipe with different connection types, the part must be constructed in such a way that the value of the attribute ANSCHLUSSART is smaller than the value of the attribute ANSCHLUSSART2.	
	Example: Let us assume that you require a pipe that can be butt-welded at one end, and has a screwed socket at the other end.	
	The connection type for butt-welded connections is 10000, the one for screwed sockets is 32000. This means that Connection 1 (Point designation "!") is required for the welded connection (ANSCHLUSSART = 10000) and Connection 2 (point designation "2") is required for the screwed connection (ANSCHLUSSART2 = 32000).	

HiCAD Plant Engineering 33 / 158

Attribute	Designation	1	
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):			
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for	
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-	
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of	
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.	
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4200x	Plugged, socket		
5100x	Socket-welded, nipple		
5200x	Socket-welded, socket		


The last character (x) provides information about the meaning of the supplement:

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected
The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Y-Piece

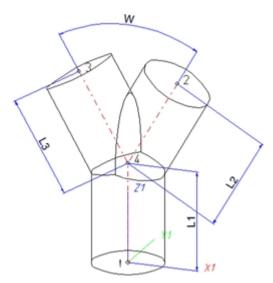

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Connecting point		X < 0, Y = 0, Z > 0
4	Auxiliary point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part

HiCAD Plant Engineering 35 / 158

Attribute	Description	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter, Connection "!"	
NENNWEITE2	Nominal diameter, Connection"2" and "3"	
Additionally (only if the corresponding standard	d uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection"!"	
NPS2_INCH	Nominal diameter (inches), Connection"2" and "3"	
These parameters are to be considered for all c necting sockets they refer to the pipe to be inse	onnection types except for flange connections. For con- rted:	
D_AUSSEN	Outer diameter, Connection"!"	
D2_AUSSEN	Outer diameter, Connection"2" and "3"	
WANDDICKE	Wall thickness, Connection"!"	
WANDDICKE2	Wall thickness, Connection"2" and "3"	
ANSCHLUSSART	Connection type, Connection"!"	
ANSCHLUSSART2	Connection type, Connection"2" and "3"	

Attribute		Description			
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):					
1000x 2000x	Butt-welded Flange connection	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for			
2100x	Flange with groove connection	a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket	no magning of the cumplement.			

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 37 / 158

⁰=No supplement

 $^{{\}bf 2} = {\sf The \ supplement \ consists \ of \ connection \ number, \ part \ type, \ ID, \ and \ standard \ of \ the \ part \ to \ be \ connected}$

Part Type: Cap

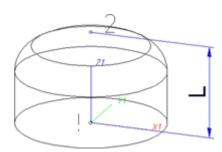

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard
NENNWEITE	Nominal diameter, Connection "!"
D_AUSSEN	Outer diameter, Connection "!"
WANDDICKE	Wall thickness, Connection "!"

Additionally (only if the corresponding standard uses nominal diameters in inches):

Attribute	Description	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection "!"	
ANSCHLUSSART	Connection type, Connection "!"	
Possible values of the attribute ANSCHILISSART (CONNECTION TYPE).		

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

rossible values of the attribute ANSCITEOSSANT (CONNECTION_TTTEL):.					
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x The last char	5200x Socket-welded, socket The last character (x) provides information about the meaning of the supplement:				

0 = No supplement


The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 39 / 158

 $[\]mathbf{2}$ = The supplement consists of connection number, part type, ID, and standard of the part to be connected

Part Type: Knee

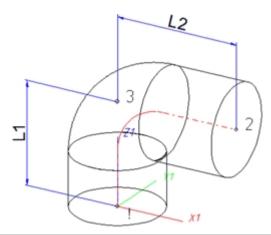

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Corner point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.	

Attribute		Description		
NENNWE	EITE	Nominal diameter, Connection "!"		
NENNWE	EITE2	Nominal diameter, Connection "2"		
WINKEL		Angle between the distances "3" -> "!" and "3" -> "2"		
Additiona	ally (only if the corresponding	g standard uses nominal diameters in inches):		
NPS_INCH		Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection "!"		
NPS2_IN	СН	Nominal diameter (inches), Connection "2"		
necting s	sockets they refer to the pipe			
D_AUSSE	EN	Outer diameter, Connection "!"		
D2_AUSS	SEN	Outer diameter, Connection "2"		
WANDDI	CKE	Wall thickness, Connection "!"		
WANDDI	CKE2	Wall thickness, Connection "2"		
ANSCHL	USSART	Connection type, Connection "!"		
ANSCHL	USSART2	Connection type, Connection "2"		
Possible	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):		
1000x	Butt-welded	Provide auxiliary part when fitting part		
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-		
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of		
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40		
2040x	Flange connection of a part that is not a flange itself. The part has			

a loose flange that is modelled as a sub-part and has no own article master attached to this connection. 3100x Screwed, nipple 3200x Screwed, socket 4100x Plugged, nipple 4200x Plugged, socket 5100x Socket-welded, nipple 5200x Socket-welded, socket

The last character (x) provides information about the meaning of the supplement:

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected


The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 41 / 158

⁰=No supplement

Part Type: Cross

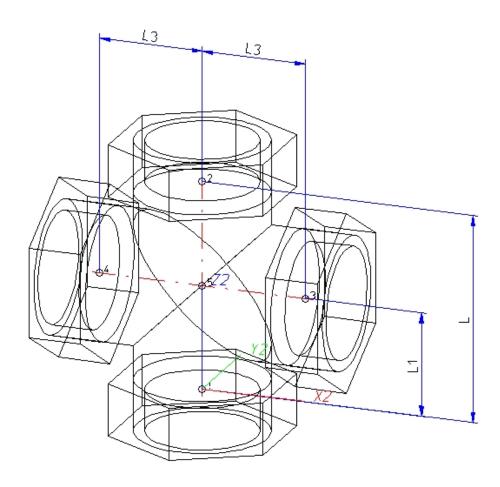

Position of connecting points and determination of insertion lengths for various connection types					
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Corner point	on branch	X > 0, Y = 0, Z > 0
4	Corner point	on branch	X < 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!" and "2"
NENNWEITE3	Nominal diameter, Connection "3" and "4"
Additionally (only if the correspond	ling standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection "!" and "2"
NPS3_INCH	Nominal diameter (inches), Connection "3" and "4"
necting sockets they refer to the pi	
D_AUSSEN	Outer diameter, Connection "!" and "2"
D3_AUSSEN	Outer diameter, Connection "3" and "4"
WANDDICKE	Wall thickness, Connection "!" and "2"
WANDDICKE3	Wall thickness, Connection "3" and "4"
ANSCHLUSSART	Connection type, Connection "!", "2", "3" and "4"

HiCAD Plant Engineering 43 / 158

Attribute		Description
Possible v	alues of the attribute ANSCHL	.USSART (CONNECTION_TYPE):.
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION TYPE) attribute for
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket-welded, nipple	
5200x	Socket-welded, socket	

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Part Type: Gauge part



Position of connecting poin	Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation Purpose		Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point or Connecting point	-	X > 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 45 / 158

Attribute		Description	
NENNWE	EITE	Nominal diameter, Connection "!"	
Additiona	ally (only if the corresponding	g standard uses nominal diameters in inches):	
NPS_INC	CH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!"	
-	rameters are to be considere ockets they refer to the pipe	ed for all connection types except for flange connections. For conto be inserted:	
D_AUSSE	EN	Outer diameter, Connection "!"	
WANDDI	CKE	Wall thickness, Connection "!"	
ANSCHL	USSART	Connection type, Connection "!"	
ANSCHL	USSART2	Connection type, Connection "2" (="0", if only one connection exists)	
Possible v	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):.	
1000x	Butt-welded	Provide auxiliary part when fitting part	
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-	
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of	
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.	
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4200x	Plugged, socket		
12001			
5100x	Socket-welded, nipple		


2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Reducer, Concentric

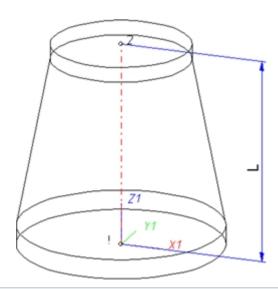

Position of connecting poin	osition of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 47 / 158

Attribute	Description		
NENNWEITE	Nominal diameter, Connection "!"		
NENNWEITE2	Nominal diameter, Connection "2"		
Additionally (only if the corresponding	ng standard uses nominal diameters in inches):		
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!"		
NPS2_INCH	Nominal diameter (inches), Connection "2"		
These managements are to be seen in	and for all connection has a successful for flower and successful for the successful for		
necting sockets they refer to the pipe	red for all connection types except for flange connections. For cone to be inserted:		
D_AUSSEN	Outer diameter, Connection "!"		
D2_AUSSEN	Outer diameter, Connection "2"		
WANDDICKE	Wall thickness, Connection "!"		
WANDDICKE2	Wall thickness, Connection "2"		
ANSCHLUSSART	Connection type, Connection "!"		
ANSCHLUSSART2	Connection type, Connection "2"		
Possible values of the attribute ANSCI	HLUSSART (CONNECTION_TYPE):		
1000x Butt-welded	Provide auxiliary part when fitting part		
2000x Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40		
2100x Flange with groove connection			
2200x Flange with notch connection			
0040	EN 1002 1/11/M/PN 40 is the standard designation with which the flange is to be		

EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.

2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.
3100x	Screwed, nipple
3200x	Screwed, socket
4100x	Plugged, nipple
4200x	Plugged, socket
5100x	Socket-welded, nipple
5200x	Socket-welded, socket

The last character (x) provides information about the meaning of the supplement:


2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Reducer, Excentric

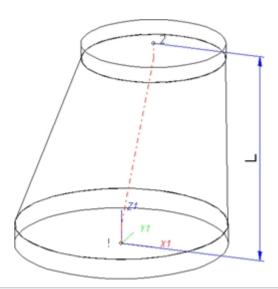

Position of connecting poin	osition of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation Purpose		Comment Position in coordinate sys	
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 49 / 158

Attribute	Description	
NENNWEITE	Nominal diameter, Connection "!"	
NENNWEITE2	Nominal diameter, Connection "2"	
Additionally (only if the co	rresponding standard uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!"	
NPS2_INCH	Nominal diameter (inches), Connection "2"	
necting sockets they refer	Outer diameter, Connection "!"	
D_AUSSEN	Outer diameter, Connection "!"	
D2_AUSSEN	Outer diameter, Connection "2"	
WANDDICKE	Wall thickness, Connection "!"	
WANDDICKE2	Wall thickness, Connection "2"	
ANSCHLUSSART	Connection type, Connection "!"	
ANSCHLUSSART2	Connection type, Connection "2"	
Possible values of the attri	bute ANSCHLUSSART (CONNECTION_TYPE):.	
1000x Butt-welded	Provide auxiliary part when fitting part	
2000x Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-	

2000x Flange connection 2100x Flange with groove connection 2200x Flange with notch connection 2040x Flange connection of a part that is not a flange itself. The part has

is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.

nection.

3100x Screwed, nipple3200x Screwed, socket4100x Plugged, nipple4200x Plugged, socket

5100x Socket-welded, nipple

5200x Socket-welded, socket

The last character (x) provides information about the meaning of the supplement:

 ${\bf 2} = {\sf The \, supplement \, consists \, of \, connection \, number, \, part \, type, \, ID, \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, standard \, of \, the \, part \, to \, be \, connected \, and \, the \, the \, part \, to \, be \, connected \, and \, the \,$

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.


If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

 $\hbox{EN 1092-1/11/A/PN 40}$ is the standard designation with which the flange is to be entered into the database.

⁰=No supplement

Part Type: Elbow

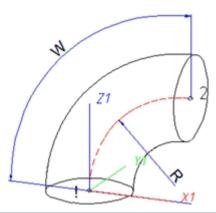

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Designation Purpose		Position in coordinate system
!	Connecting point	Fitting point	in origin(0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.
BELIEBIG_TEILBAR	Indicates whether a cutting to length of the elbow is permissible.

HiCAD Plant Engineering 51 / 158

Attribute		Description	
NENNWEITE		Nominal diameter, Connection "!" and "2"	
WINKEL		Angle	
KRUEMM	IUNG	Bend radius	
Additiona	ılly (only if the corresponding	g standard uses nominal diameters in inches):	
NPS_INC	Н	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"	
-	rameters are to be considere	ed for all connection types except for flange connections. For conto be inserted:	
D_AUSSE	N (Outer diameter, Connection "!" and "2"	
WANDDI	CKE	Wall thickness, Connection "!" and "2"	
ANSCHLU		Connection type, Connection "!" and "2" The connection types on both ends must be identical.	
Possible v	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):.	
1000x	Butt-welded	Provide auxiliary part when fitting part	
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-	
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of	
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.	
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4200x	Plugged, socket		
5100x	Socket-welded, nipple		


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Part Type: Pipe Clamp

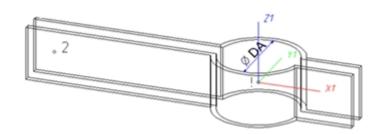

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Fitting point	Reference point placed on the centre line of a pipe during fitting	in origin (0,0,0)
2	Auxiliary point		X < 0, Y = 0, Z = 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered at least for the attributes shown below:

Possibility 1:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter	
D_AUSSEN	Outer diameter of pipe (see DA in drawing)	
Additionally (only if the corresponding standard uses nominal diameters in inches):		
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters)	

Possibility 2:


Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.
D_AUSSEN	Largest possible outer diameter of pipe that is still suitable for pipe clamp

HiCAD Plant Engineering 53 / 158

Attribute	Description	
D2_AUSSEN	Smallest possible outer diameter of pipe that is still suitable for pipe clamp	
NENNWEITE	Nominal diameter matching D_AUSSEN	
Additionally (only if the corresponding standard uses nominal diameters in inches):		
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters)	

For the insertion of a pipe clamp having these two outer diameter attributes the Also use Outer diameter 2 as search criterion for pipe clamps checkbox on the Part search tab of the Plant Engineering Settings dialogue must be active.

Part Type: Vessels, Pumps, Other components

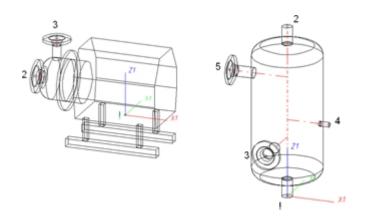

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point or Auxiliary point	Fitting point	in origin (0,0,0)
2, 3, 4 etc., unambiguous within the part	Connecting points or Auxiliary points		arbitrary

Connecting points should preferably be created via the **Component connection** function or by the insertion of nozzles.

Each component connection (and the fitting point, if it is an auxiliary point) needs to be located in a plane belonging to the part. It needs however not be located within the surface boundary.

Example



If the connecting point is located in the plane of the ring surface, the surface condition is fulfilled.

Caution: It would also be fulfilled if the point would be located in the same plane, but outside of the ring.

To assign an unambiguous orientation to a connection, a connecting point must not fulfil the surface condition for several surfaces at once.

Required attributes for entries into database or catalogue


The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	

HiCAD Plant Engineering 55 / 158

Part Type: Nozzle

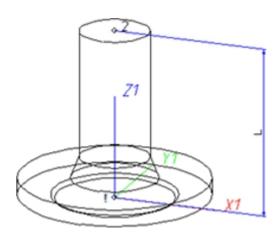

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!" and "2"
D_AUSSEN	Outer diameter, Connection ["!" and] "2"

Attribute		Description			
WANDDI	CKE	Wall thickness, Connection ["!" and] "2"			
Additiona	ally (only if the corresponding	g standard uses nominal diameters in inches):			
NPS_INC	CH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connections "!" and "2"			
ANSCHL	USSART	Connection type, Connection "!"			
ANSCHL	USSART2	Connection type, Connection "2" (value always 10000)			
Possible	values of the attribute ANSCH	LUSSART (CONNECTION_TYPE):.			
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2100x	Flange with groove connection				
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

0=No supplement

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.


HiCAD Plant Engineering 57 / 158


^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Part Type: Other Pipe Part

Up to 4 connections are possible for this part type.

The connections "!" and "2" need to be located on the Z-axis. The position of further connections is arbitrary. However, connections "3" and "4" cannot process guidelines during part insertion. The creation of guidelines starting from connections "3" and "4" can only be performed subsequently. Therefore, you will only have the following fitting options:

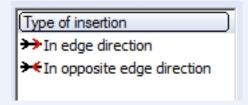

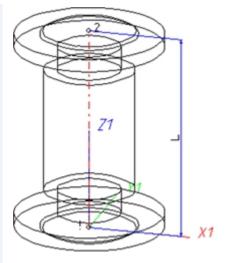

Example: Compensator with flanges

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	optional	arbitrary
4	Connecting point	optional	arbitrary

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

For a part with two connections, values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part

Attribute			Description
NORMBEZEICHNUNG			Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.
NENNWE	TITE		Nominal diameter, Connection "!" and "2"
			Tremmar diameter, commodition 1: and 2
Additiona	ally (only if the corresponding	g standard	uses nominal diameters in inches):
NPS_INC	H		Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"
-	rameters are to be considere ockets they refer to the pipe		onnection types except for flange connections. For con- rted:
D_AUSSE	N		Outer diameter, Connection "!" and "2"
WANDDI	CKE		Wall thickness, Connection "!" and "2"
ANSCHLUSSART			Connection type, Connection"!" and "2"
Possible v	values of the attribute ANSCH	LUSSART	(CONNECTION_TYPE):
1000x	Butt-welded		uxiliary part when fitting part
2000x	Flange connection		iately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for on, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection		e attribute for the connection when being fitted. For example, if the part has innection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSC	HLUSSART (CONNECTION_TYPE) attribute could look as follows: 100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.		1/11/A/PN 40 is the standard designation with which the flange is to be to the database.
3100x	Screwed, nipple		
	Comment		
3200x	Screwed, socket		
3200x 4100x	Plugged, nipple		
4100x	Plugged, nipple		

⁰=No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 59 / 158

As mentioned above, the part can have up to 4 connections. If a connection "4" exists, it needs to have the same properties (nominal diameter, outer diameter, wall thickness, connection type) as connection "3". For three connections, different properties can be preset:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!"
NENNWEITE2	Nominal diameter, Connection "2"
NENNWEITE3	Nominal diameter, Connection "3" [and "4"]
Additionally (only if the correspon	ding standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection "!" and "2"
NPS2_INCH	Nominal diameter (inches), Connection "2"
NPS3_INCH	Nominal diameter (inches), Connection "3" [and "4"]
These parameters are to be consinecting sockets they refer to the p	dered for all connection types except for flange connections. For concipe to be inserted: Outer diameter, Connection "!"
D2 AUSSEN	Outer diameter, connection "2"
D3 AUSSEN	Outer diameter, Connection "3" [and "4"]
WANDDICKE	Wall thickness, Connection "!"
WANDDICKE2	Wall thickness, Connection "2"
WANDDICKE3	Wall thickness, Connection "3" [and "4"]
ANICOLULICOADT	
ANSCHLUSSARI	Connection type for all connections
ANSCHLUSSART ANSCHLUSSART2	Connection type for all connections Connection type for Connection "2", if different from that for Connection "1"

Part Type: T-Piece

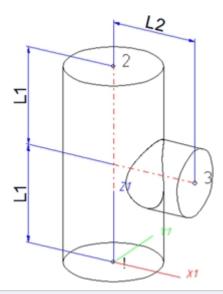

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part

HiCAD Plant Engineering 61 / 158

Attribute	Description	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter, Connection "!" and "2"	
NENNWEITE3	Nominal diameter, Connection "3"	
Additionally (only if the corresponding standard	d uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the " consists of two " characters), Connection "!" and "2"	
NPS3_INCH	Nominal diameter (inches), Connection "3"	
ANSCHLUSSART	Connection type, Connection "!" and "2"	
ANSCHLUSSART3	Connection type, Connection "3"	
These parameters are to be considered for all connection types except for flange connections. For connecting sockets they refer to the pipe to be inserted:		
D_AUSSEN	Outer diameter, Connection "!" and "2"	
D3_AUSSEN	Outer diameter, Connection "3"	
WANDDICKE	Wall thickness, Connection "!"	
WANDDICKE3	Wall thickness, Connection "3"	

Attribute		Description			
Possible v	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):				
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION TYPE) attribute for			
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				
The last character (x) provides information about the meaning of the supplement					

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

HiCAD Plant Engineering 63 / 158

⁰=No supplement

 $^{{\}bf 2} = {\sf The \ supplement \ consists \ of \ connection \ number, \ part \ type, \ ID, \ and \ standard \ of \ the \ part \ to \ be \ connected}$

Part Type: 4-Way Valve

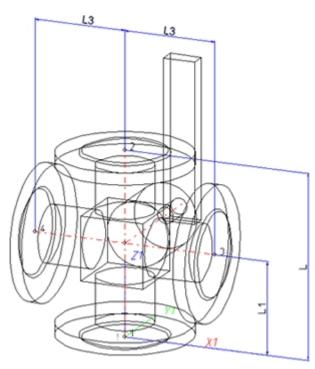

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinates system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0
4	Connecting point	on branch	X < 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!" and "2"
NENNWEITE3	Nominal diameter, Connection"3" and "4"
Additionally (only if the correspond	nding standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two" characters), Connection"!" and "2"
NPS3_INCH	Nominal diameter (inches), Connection "3" and "4"
These parameters are to be cons necting sockets they refer to the	sidered for all connection types except for flange connections. For conpipe to be inserted:
D_AUSSEN	Outer diameter, Connection"!" and "2"
D3_AUSSEN	Outer diameter, Connection"3" and "4"
WANDDICKE	Wall thickness, Connection"!" and "2"
WANDDICKE3	Wall thickness, Connection"3" and "4"
ANSCHLUSSART	Connection type for Connection"!", "2", "3" and "4"

HiCAD Plant Engineering 65 / 158


Attribute		Description		
Possible v	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):			
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for		
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has		
2100x	Flange with groove connection	a flange connection and the corresponding counter-flange is required, the content of		
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40		
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.		
3100x	Screwed, nipple			
3200x	Screwed, socket			
4100x	Plugged, nipple			
4200x	Plugged, socket			
5100x	Socket-welded, nipple			
5200x	Socket-welded, socket			

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected
The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

⁰=No supplement

Part Type: Seal

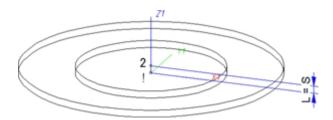

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Designation	
BENENNUNG	Designation of part	
NORMBEZEICHNUNG	Standard designation of the part.	
	An entry is mandatory, even if the part corresponds to no standard.	
NENNWEITE	Nominal diameter, Connections "!" and "2"	
DICKE	Seal thickness	
Additionally (only if the corresponding s	tandard uses nominal diameters in inches):	
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the " consists of two " characters), Connections "!" and "2"	
ANSCHLUSSART	Connection types for Connections "!" and "2" (value = 20000 for flange connection)	

HiCAD Plant Engineering 67 / 158

Attribute		Designation	
Possible v	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):		
2000x	Flange connection	Provide auxiliary part when fitting part	
2100x	Flange with groove connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_ TYPE) attribute for a connection, the part will provide and connect an	
2200x	Flange with notch connection	auxiliary part of the standard specified in the attribute for the con- nection when being fitted. For example, if the part has a flange con-	
2050x	Flange connection of a seal that is exintended for the pushed in end of a pipe. The effect of this value is that flange, together with the push-in pipe connected to the seal. The pushed push-in pipe must have the connections.	content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40 is the standard designation with which the flagge is to be entered into the database.	

0=No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Pressure ranges

In previous versions the nominal pressure was of no significance for the search of matching sealing gaskets. To take pressures ranges into account, the attribute **DRUCK_MIN** (Minimum pressure) is now available.

When you now search a sealing gasket for a flange, the following, additional search condition will be generated from the nominal pressure **PN** of the flange:

(MIN_DRUCK ist unbelegt oder MIN_DRUCK <= PN) und (DRUCK ist unbelegt oder DRUCK >= PN) (Minimum pressure not specified or Minimum pressure <=PN) and (Minimum pressure not specified or Minimum pressure >=PN)

Sealing gaskets without pressure specifications will thus be handled as if they were suitable for any nominal pressure.

The standard parts that are by default supplied with HiCAD do not include sealing gaskets with a defined pressure range. Therefore, this new feature is currently only relevant for gaskets that have been created by the user. Accordingly, the attribute DRUCK_MIN (Min. pressure) will not be available in the search masks that are by default supplied with HELiOS. If desired, you can add this attribute with the HELiOS Mask Editor.


If you prepare the database for Plant Engineering by clicking the corresponding button in DBPlantDataImport.exe, the attribute **DRUCK_MIN** will be entered, with the designation **Minimum pressure**, into the database.

An example from practice:

If you do not want gaskets with an own article number for each pressure level to be created, you can avoid this by means of the **DRUCK_MIN** attribute.

Furthermore, you have now the option to narrow search results for sealing gaskets by specifying a value for the attribute **DRUCK** (Pressure), e.g. by including only gaskets with a defined pressure in your pipe class.

Part Type: Fastener

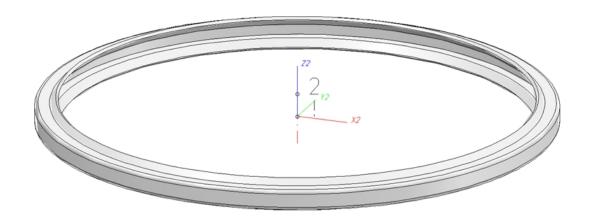

Named isolated points

Designation	Function	Comment	Position in coordinate system
!	Connecting point	Fitting point	In origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

The part has no insertion length. When the part is inserted, it will be placed with its fitting point onto a connection of the target part. Connecting point 2 will only be used for a correct alignment.

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:


alass note to be sincrea for at least the following attributes.		
Attribute	Description	
BENENNUNG	Designation of the part	
NORMBEZEICHNUNG	Standard designation of the part An entry will even be required if the part corresponds to no standard.	
ANSCHLUSSART	Connection type for which the fastener is intended.	
NENNWEITE	Nominal diameter intended for the fastener.	
Additionally (only if the corresponding standard	uses nominal diameters in inches):	
NPS_INCH	Nominal diameter in inches (e.g. 1 1/2", the "consist of 2 'characters)	
These additional values make sense if the above attributes should not be sufficient as search criteria:		
D_AUSSEN	Outer diameter for which the fastener is intended	
WANDDICKE	Wall thickness for which the fastener is intended	

HiCAD Plant Engineering 69 / 158

Attribute		Descrip	tion		
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):					
20000	Flange connection		lease note:		
2040x	Flange connection of a part that is not a flange it The part has a loose flange that is modelled as a s part and has no own article master attached to this nection.	self. co ub- th	The option to specify, via the attribute ANSCHLUSSART, a connected part that will automatically be inserted together with the part (if the corresponding option has been set) is not available here.		
42000	Plugged, socket				
51000	Socket-welded, nipple				
52000	Socket-welded, socket				

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Part Type: Saddle Connection / Elbolet

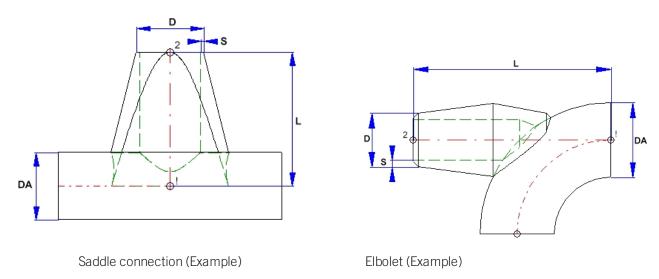

D=Outer diameter of the nozzle, DA=Outer diameter of the part to which the connection is made, L=Length, S=Wall thickness

Please note that the variable DA (Outer diameter) will be modified upon insertion. It will be applied to the outer diameter of the pipe to which the connection is made. This allows the calculation of the part geometry to match the respective fitting situation. Please check whether the geometry of the constructed saddle connection correctly adjust itself to a modified DA value.

Position of connecting points and determination of insertion lengths for various connection types							
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection				
a 2	a	a 2	a 2				
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)				

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

HiCAD Plant Engineering 71 / 158

Required attributes for entries into database or catalogue

The entering of attribute values and the part type selection should be performed using the PAA Editor.

Values need to be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
NORMBEZEICHNUNG	Standard designation of the part.
	An entry is mandatory, even if the part corresponds to no standard.
NENNWEITE	Nominal diameter, Connection "!" and "2"
Additionally (only if the c	orresponding standard uses nominal diameters in inches):
NPS_INCH	Nominal diameter (inches) (e.g. 1 1/2", the "consists of two "characters), Connection"!" and "2"
These sizes are to be cor they refer to the pipe to b	nsidered for all connection types except for the flange connection. For sockets be inserted:
D_AUSSEN	Outer diameter of the part to which the connection is made. This allows a suitable adjustment of the nozzle.
D2_AUSSEN	Outer diameter of the nozzle, Connection "!" and "2"
WANDDICKE	Wall thickness, Connection "2"
ANSCHLUSSART	Connection type for Connection "!"(and "2")
ANGCITEOGGANT	If the same connection type is required at both part ends it will suffice to assign a
ANSCHLUSSART2	value to the attribute ANSCHLUSSART.
	If different connection types are required at the part ends you need to assign the value of the connection type for Connection 1 to the attribute ANSCHLUSSART, and the connection type for Connection 2 to the attribute ANSCHLUSSART2.

Attribute		Description	า
	values of the TION_TYPE2):	e attributes	ANSCHLUSSART (CONNECTION_ TYPE) and ANSCHLUSSART2
1000x	Butt-welded		Provide auxiliary part when fitting part
2000x	Flange connection		If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove	connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch of	connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection is not a flange itself a loose flange that i a sub-part and ha icle master attache nection	The part has is modelled as as no own art-	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple		
3200x	Screwed, socket		
4100x	Plugged, nipple		
4200x	Plugged, socket		
5100x	Socket-welded, nip	ople	
5200x The last chara	Socket-welded, so acter (x) provides inf		the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Creating Individual Parts: Procedure (PE)

HiCAD Plant Engineering 73 / 158

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Rules for the Creation of User-Defined Feature Variants


When creating new, user-defined Feature Variants for Plant Engineering Parts, certain rules, depending on the particular part type, need to be respected.

When using your own variants for flanges or parts with flanges, please read the notes on bolted flange connections!

- Variant for Part Type: Branch
- Variant for Part Type: Valve
- Variant for Part Type: Blank flange
- Variant for Part Type: Double knee
- Variant for Part Type: Three-way valve
- Variant for Part Type: Corner valve
- Variant for Part Type: Flange
- Variant for Part Type: Straight pipe
- Variant for Part Type: Y-piece
- Variant for Part Type: Cap
- Variant for Part Type: Knee
- Variant for Part Type: Cross
- Variant for Part Type: Gauge part
- Variant for Part Type: Reducer, concentric
- Variant for Part Type: Reducer, excentric
- Variant for Part Type: Elbow
- Variant for Part Type: Pipe clamp
- Variant for Part Type: Vessels, Pumps, Other Components
- Variant for Part Type: Nozzles
- Variant for Part Type: Other pipe parts
- Variant for Part Type: T-piece
- Variant for Part Type:4-way valve
- Variant for Part Type: Seal
- Variant for Part: Fastener
- Variant for Part: Saddle connection / Elbolet

HiCAD Plant Engineering 75 / 158

Variant for Part Type: Branch

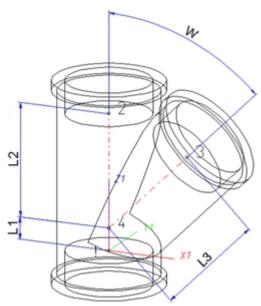

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0
4	Auxiliary point	Branching point of centre line	X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L1	Length of distance between points "!" und "4"	LAENGE1
L2	Length of distance between points "2" und "4"	LAENGE2
L3	Length of distance between points "3" und "4"	LAENGE3

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Nominal diameter, Connection "2"	N2	NENNWEITE2
Nominal diameter, Connection "3"	N3	NENNWEITE3
Angle	W	WINKEL
Additionally (only if the correspond	ding standard uses nominal diameter	s in inches):
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameter (inches), Connection "2"	NI2	N2_INCH
Nominal diameter (inches), Connection "3"	NI3	N3_INCH
The nominal diameters in inches ne	ed to be entered as decimal values as	well (e.g. 1.5 for 1 1/2").
These parameters are to be considered necting sockets they refer to the p	lered for all connection types except ipe to be inserted:	for flange connections. For con-
Outer diameter, Connection "!"	D	D_AUSSEN
Outer diameter, Connection "2"	D2	D2_AUSSEN
Outer diameter, Connection "3"	D3	D3_AUSSEN
Wall thickness, Connection "!"	S	WANDDICKE
Wall thickness, Connection "2"	S2	WANDDICKE2
Wall thickness, Connection "3"	S3	WANDDICKE3

If required, the attributes LAENGE1, LAENGE2 and LAENGE3 need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

HiCAD Plant Engineering 77 / 158

Attribute	Description	
BENENNUNG	Part designation	
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only	
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!)	
	An entry is mandatory, even if the part corresponds to no standard.	
ANSCHLUSSART	Connection type for Connection "!"	
ANSCHLUSSART2	Connection type for Connection "2"	
ANSCHLUSSART3	Connection type for Connection "3"	
Possible values of the attribute ANSCHLUSSART (CONNECTION TYPE):		

1000x	Butt-welded	
2000x	Flange connection	
2100x	Flange with groove connection	
2200x	Flange with notch connection	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	

Plugged, socket

Socket-welded, nipple

Socket-welded, socket

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

4200x

5100x

5200x

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_ INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH...

⁰⁼No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Valve

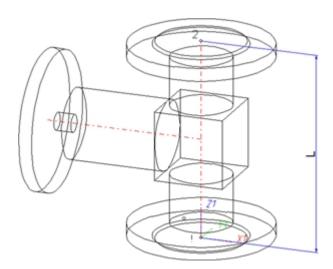

The centre axis of the actuator should be located in the plane X < 0, Y = 0, Z > 0.

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between point"!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

HiCAD Plant Engineering 79 / 158

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be considered necting sockets they refer to the pi	ered for all connection types except f pe to be inserted:	or flange connections. For con-
Outer diameter, Connection "!" and "2"	D	D_AUSSEN
Wall thickness, Connection "!" and "2"	S	WANDDICKE

If required, the attribute LAENGE need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!" and "2"

Attribute		Description		
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):.				
1000x	Butt-welded	Provide auxiliary part when fitting part		
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-		
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of		
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40		
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.		
3100x	Screwed, nipple			
3200x	Screwed, socket			
4100x	Plugged, nipple			
4200x	Plugged, socket			
5100x	Socket-welded, nipple			
5200x	Socket-welded, socket			

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:


During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 81 / 158

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Blank Flange

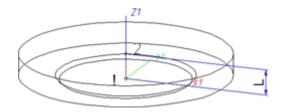

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between points "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA files

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Additionally (only if the corresponding standard uses nominal diameters in inches):		
Nominal diameter (inches), Connection "!" NI N_INCH		N_INCH
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").		

If required, the attribute LAENGE need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part

Attribute	Description
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!" (always flange connection)
ANSCHLUSSART2	Connection type for connection "2" (always 0)

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1000x	Butt-welded	Provide auxiliary part when fitting part
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the
2100x	Flange with groove con- nection	part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange
2200x	Flange with notch connection	connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART
3100x	Screwed, nipple	(CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
3200x	Screwed, socket	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
4100x	Plugged, nipple	with which the hange is to be entered into the database.
4200x	Plugged, socket	
5100x	Socket-welded, nipple	
5200x	Socket-welded, socket	

The last character (x) provides information about the meaning of the supplement:

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.


HiCAD Plant Engineering 83 / 158

⁰⁼No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Variant for Part Type: Double Knee

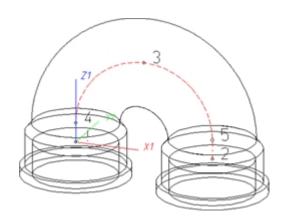

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (X1=0,Y1=0,Z1=0)
2	Connecting point		X2 > 0, Y2 = 0, Z2 = 0
3	Auxiliary point		X3 = X2/2, Y3 = 0, Z3 > Z4
4	Auxiliary point		X4 = 0, Y4 = 0, Z4 > 0
5	Auxiliary point		X5 = X2, Y5 = 0, Z5 = Z4

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

and that the predemied attribute assignment is entered:		
Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Additionally (only if the corresponding standard uses nominal diameters in inches):		
radiationally (only in the correspond		
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").		(e.g. 1.5 for 1 1/2").
These parameters are to be considered for all connection types except for flange connections. For connecting sockets they refer to the pipe to be inserted:		
Outer diameter, Connection "!" and "2"	D	D_AUSSEN

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Wall thickness, Connection "!" and "2"	S	WANDDICKE

If required, the attributes LAENGE1 and LAENGE2 need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!)
	An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!"
ANSCHLUSSART2	Connection type for connection "2"

HiCAD Plant Engineering 85 / 158

Attribute		Description		
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):				
1000x		rovide auxiliary part when fitting part appropriately preset in the ANSCHLUSSART (CONNECTION TYPE) attribute for		
2000x	Flange connection a	connection, the part will provide and connect an auxiliary part of the standard spe-		
2100x	Flange with groove connection	fied in the attribute for the connection when being fitted. For example, if the part has flange connection and the corresponding counter-flange is required, the content of		
2200x	riange with notch connection	e ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 0002 1 5100010 EN 1092-1/11/A/PN 40		
2040x	riange connection of a part that	N 1092-1/11/A/PN 40 is the standard designation with which the flange is to be ntered into the database.		
3100x	Screwed, nipple			
3200x	Screwed, socket			
4100x	Plugged, nipple			
4200x	Plugged, socket			
5100x	Socket-welded, nipple			
5200x	Socket-welded, socket			

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: 3-Way Valve

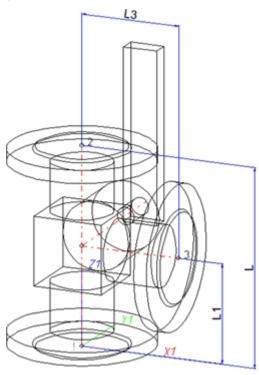

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0

HiCAD Plant Engineering 87 / 158

Variables names

Name	Description	Attribute (optional)
L	Length of distance between points "!" and "2"	LAENGE
L1	Length of distance between point "!" and branching point of centre line	LAENGE1
L3	Distance of point "3" from the line through "!" and "2"	LAENGE3

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.

intent is chicica.	
Variable (suggestion)	Assigned attribute
N	NENNWEITE
N3	NENNWEITE3
ing standard uses nominal diameters	in inches):
NI	N_INCH
NI3	N3_INCH
be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
	or flange connections. For con-
D	D_AUSSEN
D3	D3_AUSSEN
S	WANDDICKE
S3	WANDDICKE3
	Variable (suggestion) N N3 ing standard uses nominal diameters NI NI3 be entered as decimal values as well ered for all connection types except for the be inserted: D D3 S

If required, the attributes LAENGE, LAENGE1 and LAENGE3 need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for Connection "!", "2" und "3"

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):.

1000x	Butt-welded
2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.
3100x	Screwed, nipple
3200x	Screwed, socket
4100x	Plugged, nipple
4200x	Plugged, socket
5100x	Socket-welded, nipple

Socket-welded, socket

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

EN~1092--1/11/A/PN~40 is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

5200x

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:


During part data synchronization, nominal diameters in inches will be taken over to the attributes N_{NCH} , $N2_{NCH}$ and $N3_{NCH}$. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_{NCH} , NPS_{NCH} und $NPS3_{NCH}$.

HiCAD Plant Engineering 89 / 158

⁰⁼No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Corner Valve

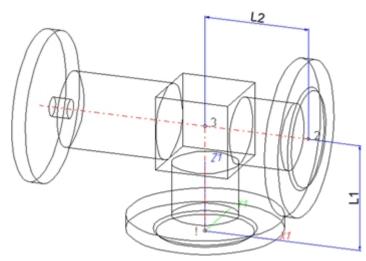

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Corner point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L1	Distance between point "!" and "3"	LAENGE1
L2	Distance between point "3" and "2"	LAENGE2

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Nominal diameter, Connection "2"	N2	NENNWEITE2
Additionally (only if the correspond	ding standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameter (inches), Connection "2"	NI2	N2_INCH
Nominal diameters in inches need t	o be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be considered necting sockets they refer to the p	dered for all connection types except ipe to be inserted:	for flange connections. For con-
Outer diameter, Connection "!"	D	D_AUSSEN
Outer diameter, Connection "2"	D2	D2_AUSSEN
Wall thickness , Connection "!"	S	WANDDICKE
Wall thickness , Connection "2"	S2	WANDDICKE2

If required, the attributes LAENGE1 and LAENGE2 need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished products * Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!" and "2"

HiCAD Plant Engineering 91 / 158

Attribute		Description
Possible v	alues of the attribute ANSCHL	USSART (CONNECTION_TYPE):.
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket-welded, nipple	
5200x	Socket-welded, socket	

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Flange

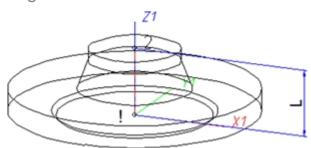

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Designation	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column...

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE

HiCAD Plant Engineering 93 / 158

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Additionally (only if the corresponding standard	uses nominal diameters in incl	nes):
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").		
For connecting sockets these parameters refer to	o the pipe to be inserted:	
Outer diameter, Connection "2"	D	D_AUSSEN
Wall thickness, Connection "2"	S	WANDDICKE

If required, the attribute LAENGE needs to be assigned to the length variables (see Variables names above).

For flangings, an additional variable F1 is available, which determines the distance of the loose flange from connecting point 1 of the flanging. For flangings (welding necks, collar pieces etc), F1 normally equals the wall thickness.

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!" (always flange connection)
ANSCHLUSSART2	Connection type for connection "2"

Attribute		Description
Possible v	alues of the attribu	te ANSCHLUSSART (CONNECTION_TYPE):.
1000x	Butt-welded	Provide auxiliary part when fitting part
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the
2100x	Flange with groove connection	connection when being fitted. For example, if the part has a flange connection and the cor- responding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_ TYPE) attribute could look as follows:
2200x	Flange with notch connection	20002 1 5100010 EN 1092-1/11/A/PN 40 EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
2010x	Flange connection of a loose flange	
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket- welded, nipple	
5200x	Socket- welded, socket	

The last character (x) provides information about the meaning of the supplement:

0 = No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Loose flanges are assigned to the part type **Flange**. The attribute ANSCHLUSSART (=CONNECTION_TYPE), however, must have the value 20100!




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

Model welding necks as flanges

As an alternative to the modelling of flangings as straight pipes, flangings can also be modelled as flanges if desired.

HiCAD Plant Engineering 95 / 158

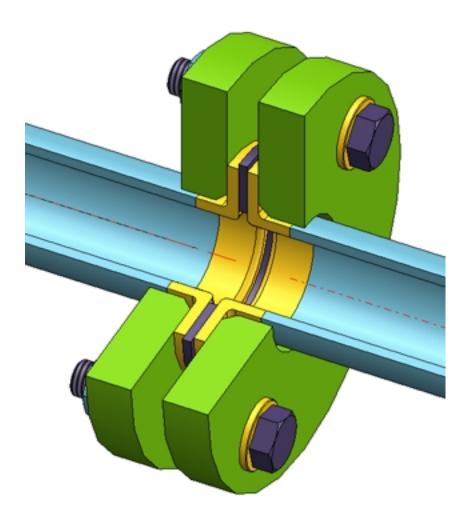

When using this procedure, the flanging must be of the type "Flange", while the loose flange is an asymmetrical fastener. The flange connection of the flanging must have the connection type 20600. The 6 coming in the third place encodes the asymmetrical fastener with flange connection, i.e. normally a loose flange classified as fastener. For this procedure the variable F1 will also determine the distance of the loose flange to connecting point 1 of the flanging. For welding necks, F1 normally equals the wall thickness.


In contrast to flangings that are modelled as straight pipes, the flange symbol is assigned to the flanging here. This ensures that the position of the flange symbol in a generated isometry will not be affected by a possible moving of the loose flange.



Please note:

If you want to fix the loose flange by a welding point, you should not model it as a fastener, as fasteners do not support welding points on connecting points 2. In this case you must use genuine loose flanges, i.e. such flanges that are actually classified as flanges.

Variant for Part Type: Straight Pipe

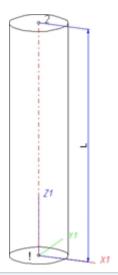

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	In origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

HiCAD Plant Engineering 97 / 158

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal width, Connection "!" and "2"	N	NENNWEITE
Length (if a cutting to length of the pipe is permissible, the value is arbitrary. The length needs however to be smaller than the supplied length.)	L	LAENGE
		,
Additionally (only if the corresponding standard uses noming Number of Georgestian "I" and "2"		N INCL
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
	NI	
Nominal diameter (inches), Connection "!" and "2"	NI alues as well (e.g. 1.5 for	1 1/2").
Nominal diameter (inches), Connection "!" and "2" Nominal diameters in inches need to be entered as decimal v These parameters are to be considered for all connection to	NI alues as well (e.g. 1.5 for	1 1/2").

If required, the attribute LAENGE needs to be assigned to the length variables (see Variables names above).

For flangings, the additional variables F1 and F2 are available, for the distance of the loose flange to the flanging edge.

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) <u>for HELiOS data-base only</u>
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
BELIEBIG_TEILBAR	Indicates whether the cutting to length of the pipe, is permissible.
LIEFERLAENGE	Supplied length in m (!)
ANSCHLUSSART	Connection type for connection "!" and "2"
ANSCHLUSSART2	If you want both pipe ends to have the same connection type it will suffice to specify a value for the ANSCHLUSSART attribute.
	If you want the two pipe ends to have different connection types, the connection type for Connection 1 must be specified for the ANSCHLUSSART attribute, and the connection type for Connection 2 for the ANSCHLUSSART2 attribute.
	If you want to create a new feature variant of a straight pipe with different connection types, the part must be constructed in such a way that the value of the attribute ANSCHLUSSART is smaller than the value of the attribute ANSCHLUSSART2.
	Example:
	Let us assume that you require a pipe that can be butt-welded at one end, and has a screwed socket at the other end.
	The connection type for butt-welded connections is 10000, the one for screwed sockets is 32000. This means that Connection 1 (Point designation "!") is required for the welded connection (ANSCHLUSSART = 10000) and Connection 2 (point designation "2") is required for the screwed connection (ANSCHLUSSART2 = 32000).

HiCAD Plant Engineering 99 / 158

Attribute	Description	
. 000.0.0	values of the attribute TION_TYPE2):	ANSCHLUSSART (CONNECTION_ TYPE) and ANSCHLUSSART2
1000x	Butt-welded	Provide auxiliary part when fitting part
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket-welded, nipple	
5200x The last chara	Socket-welded, socket acter (x) provides information about th	ne meaning of the supplement

The last character (x) provides information about the meaning of the supplement:

0 = No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Important:

- When working with the **HELiOS database**, please pay attention to the correct classification matching the part type.
- During variant synchronization the **Nominal diameters in inches** will initially only be taken over into the attribute N_INCH in the form of decimal numbers. The usual character strings for the specification of the nominal diameter in inches (e.g. 1 1/2" instead of 1.5) can be subsequently generated in the HELiOS database for the attribute NPS_INCH. For this purpose the HiCAD macro ANLDB_ZOLLATTRIGEN.MAC in the \HICAD\MAKROANL folder is used.
- Please also read the information about pipe-dependent placing of loose flanges given below!


Model collar pieces as straight pipes

Loose flanges can be placed manually or automatically on the connecting point of straight pipes. In the process, the first connecting point of the loose flange will be placed on the connecting point of the straight pipe. Sometimes, however, it is desirable to move the representation of the loose flange slightly away from the connecting point, e.g. in cases where the straight pipe ends with a flanged edge which is not to be overlapped by the geometry of the loose flange.

To achieve this, you can define a suitable distance in the feature variables of the straight pipe. This distance must be stored in the Variable F1 for the first connecting point, and in the Variable F2 for the second connecting point.

Even if the end of the pipe is just a flanged end, the required connection type will be 10000 (welded connection).

The result will look as follows:

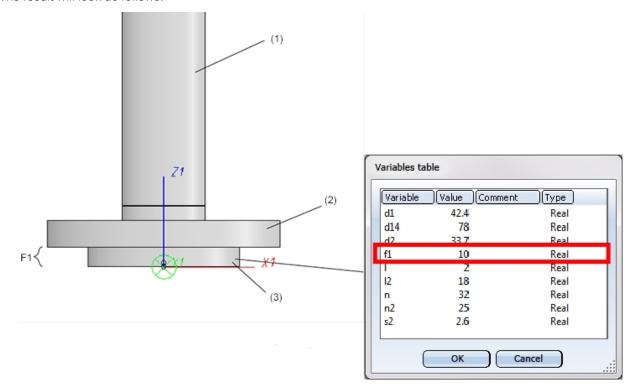

(1) Straight pipe, (2) Loose flange, (3) Collar piece, modelled as straight pipe defining a distance of the loose flange via F1 for the first connecting point.

After insertion of the loose flange, its first connecting point will still be located at the end of the straight pipe, but the part geometry and the second connecting point have been moved away from the connection by the value F1.




Please note:

- The modelling of flangings such as collar pieces as straight pipes is not optimal if you want to create an isometry of the pipeline, as the flange symbol of the loose flange will then be slightly displaced. Alternatively, you have the option to model flangings as straight pipes, so that the flange symbol is assigned to the flanging. This ensures that the position of the flange symbol in a generated isometry will not be affected by a possible moving of the loose flange.
- During manual placing of loose flanges, please bear in mind that the Guideline mode must be switched off, and that Connection 1 on target connection must have been selected during insertion.

HiCAD Plant Engineering 101 / 158

Variant for Part Type: Y-Piece

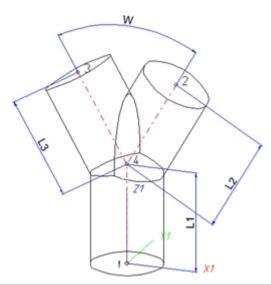

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Connecting point		X < 0, Y = 0, Z > 0
4	Auxiliary point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L1	Distance between point "!" and "4"	LAENGE1
L2	Distance between point "2" and "4"	LAENGE2
L3	Distance between point "3" and "4"	LAENGE3

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Nominal diameter, Connection "2" and "3"	N2	NENNWEITE2
Angle	W	WINKEL
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameter (inches), Connection "2" and "3"	NI2	N2_INCH
As only decimal values are saved to entered as decimal values as well (e	the VAA file as parameter values, nome.g. 1.5 for 1 1/2").	inal diameters in inches need to be
These parameters are to be considered necting sockets they refer to the parameters are to the parameters are to be considered as a second nection of the parameters are to be considered as a second nection of the parameters are to be considered as a second nection of the parameters are to be considered as a second nection of the parameters are to be considered nection of the parameters are to be con	lered for all connection types except to be inserted:	for flange connections. For con-
Outer diameter, Connection "!"	D	D_AUSSEN
Outer diameter, Connection "2" und "3"	D2	D2_AUSSEN
Wall diameter, Connection "!"	S	WANDDICKE
Wall diameter, Connection "2" and "3"	S2	WANDDICKE2

If required, the attributes LAENGE1, LAENGE2 and LAENGE3 need to be assigned to the length variables (see Variables names above).

HiCAD Plant Engineering 103 / 158

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only	
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.	
ANSCHLUSSART	Connection type for connection "!"	
NSCHLUSSART2 Connection type for connection "2" and "3"		
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):		

1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION TYPE) attribute for
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	

The last character (x) provides information about the meaning of the supplement:

0=No supplement

4100x

4200x

5100x

5200x

Plugged, nipple

Plugged, socket

Socket-welded, nipple

Socket-welded, socket

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_{INCH} , $N2_{INCH}$ and $N3_{INCH}$. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Cap

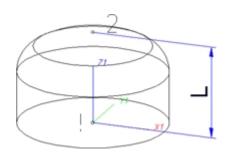

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt welding	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

Variables names

Name	Designation	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Outer diameter, Connection "!"	D	D_AUSSEN

HiCAD Plant Engineering 105 / 158

Parameter	Variable	Assigned attribute	
All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	(suggestion)		
Wall thickness, Connection "!"	S	WANDDICKE	
Additionally (only if the corresponding standard uses nominal diameters in inches):			
Nominal diameter (inches), Connection "!"	NI	N_INCH	
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").			

If required, the attribute LAENGE needs to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!"

Attribute		Description			
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):.					
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:


During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 107 / 158

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Knee

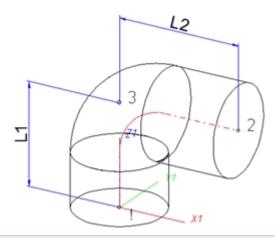

Position of connecting points and determination of insertion lengths for various connection types					
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0
3	Corner point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L1	Distance between point "!" and "3"	LAENGE1
L2	Distance between point "3" and "2"	LAENGE2

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Nominal diameter, Connection "!"	N	NENNWEITE	
Nominal diameter, Connection "2"	N2	NENNWEITE2	
Angles between the distances "3" - > "!" and "3" -> "2"	W	WINKEL	
Additionally (only if the corresponding	ng standard uses nominal diameters	in inches):	
Nominal diameter (inches), Connection "!"	NI	N_INCH	
Nominal diameter (inches), Connection "2"	NI2	N2_INCH	
Nominal diameters in inches need to	Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").		
These parameters are to be conside necting sockets they refer to the pipe		or flange connections. For con-	
Outer diameter, Connection "!"	D	D_AUSSEN	
Outer diameter, Connection "2"	D2	D2_AUSSEN	
Wall thickness, Connection "!"	S	WANDDICKE	
Wall thickness, Connection "2"	S2	WANDDICKE2	

If required, the attributes LAENGE1 and LAENGE2 need to be assigned to the length variables. (see Variables names above).

HiCAD Plant Engineering 109 / 158

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description		
BENENNUNG	Designation of part		
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only		
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.		
ANSCHLUSSART	NSCHLUSSART Connection type for Connection "!"		
ANSCHLUSSART2 Connection type for Connection "2"			
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):			
1000x Butt-welded Provide auxiliary part when fitting part			

1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part a flange connection and the corresponding counter-flange is required, the conter
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.

3200x Screwed, socket 4100x Plugged, nipple 4200x Plugged, socket 5100x Socket-welded, nipple

Screwed, nipple

Socket-welded, socket

The last character (x) provides information about the meaning of the supplement:

0=No supplement

5200x

3100x

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_ INCH and N3. The usual character strings for indication of the diameter in inches (e.g. 11/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

Variant for Part Type: Cross

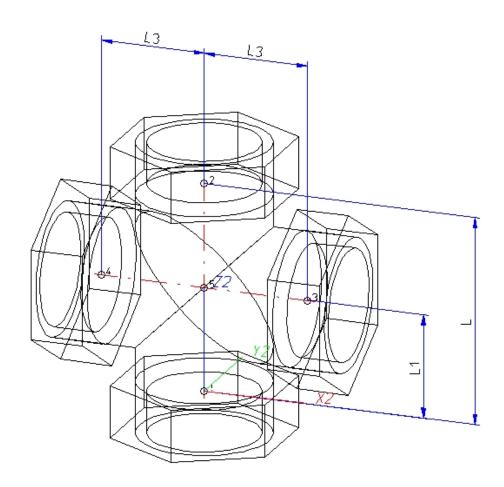

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

HiCAD Plant Engineering 111 / 158

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0
4	Connecting point	on branch	$X \le 0, Y = 0, Z > 0$

Variables names

Name	Description	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE
L1	Distance between point "!" and the intersection point of the centre lines	LAENGE1
L3	Distance between point "3" and "4"	LAENGE3

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.:

The tractine present the attribute seed, similar to entereal.			
Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Nominal diameter, Connection "!" and "2"	N	NENNWEITE	
Nominal diameter, Connection "3" and "4"	N3	NENNWEITE3	
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):	
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH	
Nominal diameter (inches), Connection "3" and "4"	NI3	N3_INCH	
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").			
These parameters are to be considered necting sockets they refer to the pi	ered for all connection types except to be inserted:	or flange connections. For con-	
Outer diameter , Connection "!" and "2"	D	D_AUSSEN	
Outer diameter, Connection "3" and "4"	D3	D3_AUSSEN	
Wall thickness, Connection "!" and "2"	S	WANDDICKE	

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Wall thickness, Connection "3" and "4"	\$3	WANDDICKE3

If required, the attributes LAENGE, LAENGE1 and LAENGE3 need to be assigned to the length variables. (see Variables names above).

HiCAD Plant Engineering 113 / 158

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for Connection "!", "2", "3" and "4"

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1000x	Butt-welded
2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.
3100x	Screwed, nipple
3200x	Screwed, socket
4100x	Plugged, nipple

Plugged, socket

Socket-welded, nipple

Socket-welded, socket

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

0=No supplement

4200x

5100x 5200x

 $\mathbf{2}$ = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

Variant for Part Type: Gauge part



Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Auxiliary point or Connecting point		X > 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.:

HiCAD Plant Engineering 115 / 158

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Additionally (anhy if the garrage and	ling standard was naminal diameter	a in inch co
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be considered necting sockets they refer to the pi	lered for all connection types except to be inserted:	for flange connections. For con-
Outer diameter , Connection "!" and "2"	D	D_AUSSEN
Wall thickness, Connection "!" and "2"	S	WANDDICKE

If required, the attribute LAENGE needs to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for Connection "!"
ANSCHLUSSART2	Connection type for Connection "2" (="0", if only one connection exists)

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1000x	Butt-welded
2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.
3100x	Screwed, nipple
3200x	Screwed, socket
4100x	Plugged, nipple
4200x	Plugged, socket

Socket-welded, nipple Socket-welded, socket

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

 $\hbox{EN 1092-1/11/A/PN 40}$ is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

0=No supplement

5100x

5200x

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

HiCAD Plant Engineering 117 / 158

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

Variant for Part Type: Reducer, Excentric

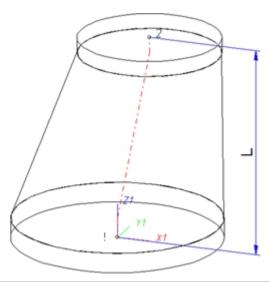

Position of connecting points and determination of insertion lengths for various connection types					
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0

Variables names

Nar	ne	Description	Attribute (optional)
L		Distance of the connecting surfaces from "!" to "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column..

HiCAD Plant Engineering 119 / 158

VAA file:

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Nominal diameter, Connection "2"	N2	NENNWEITE2
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameter (inches), Connection "2"	NI2	N2_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be consident necting sockets they refer to the pi	ered for all connection types except to be inserted:	for flange connections. For con-
Outer diameter, Connection "!"	D	D_AUSSEN
Outer diameter, Connection "2"	D2	D2_AUSSEN
Wall thickness, Connection "!"	S	WANDDICKE
Wall thickness, Connection "2"	S2	WANDDICKE2

If required, the attributes LAENGE needs to be assigned to the length variables. (see Variables names above)

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!"
ANSCHLUSSART2	Connection type for connection "2"

Attribute		Description			
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):					
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:


During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 121 / 158

^{0 =} No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Reducer, Concentric

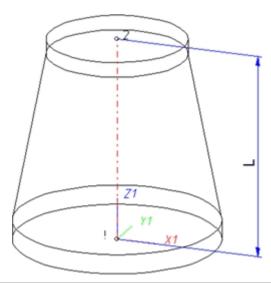

Position of connecting points and determination of insertion lengths for various connection types					
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file:

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Nominal diameter, Connection "!"	N	NENNWEITE	
Nominal diameter, Connection "2"	N2	NENNWEITE2	
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):	
Nominal diameter (inches), Connection "!"	NI	N_INCH	
Nominal diameter (inches), Connection "2"	NI2	N2_INCH	
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").	
These parameters are to be consid necting sockets they refer to the pi	ered for all connection types except to be inserted:	for flange connections. For con-	
Outer diameter, Connection "!"	D	D_AUSSEN	
Outer diameter, Connection "2"	D2	D2_AUSSEN	
Wall thickness, Connection "!"	S	WANDDICKE	
Wall thickness, Connection "2"	S2	WANDDICKE2	

If required, the attributes LAENGE needs to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!"
ANSCHLUSSART2	Connection type for connection "2"

HiCAD Plant Engineering 123 / 158

Attribute		Description			
Possible v	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):				
1000x	Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for			
2000x	Flange connection	a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Elbow

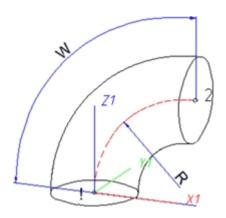

Position of connecting points and determination of insertion lengths for various connection types					
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection		
a 2	a	a 2	a 2		
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)		

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X > 0, Y = 0, Z > 0

HiCAD Plant Engineering 125 / 158

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute			
Nominal diameter, Connection "!" and "2"	N	NENNWEITE			
Angle	W	WINKEL			
Bend radius	R	KRUEMMUNG			
Additionally (only if the correspond	ding standard uses nominal diameters	s in inches):			
Nominal diameter (inches), Con- NI N_INCH nection "!" and "2"					
Nominal diameters in inches need t	o be entered as decimal values as well	(e.g. 1.5 for 1 1/2").			
These parameters are to be considered for all connection types except for flange connections. For connecting sockets they refer to the pipe to be inserted:					
Outer diameter, Connection"!" and "2"	D	D_AUSSEN			
Wall thickness, Connection "!" and "2"	S	WANDDICKE			

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
BELIEBIG_TEILBAR	Indicates whether a cutting to length of the elbow is permissible.
ANSCHLUSSART	Connection type for connections "!" and "2" The connection types on both ends must be identical.

Attribute		Description			
Possible v	Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):				
1000x	Butt-welded	Provide auxiliary part when fitting part			
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-			
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of			
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40			
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.			
3100x	Screwed, nipple				
3200x	Screwed, socket				
4100x	Plugged, nipple				
4200x	Plugged, socket				
5100x	Socket-welded, nipple				
5200x	Socket-welded, socket				

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:


During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 127 / 158

⁰=No supplement

^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Pipe Clamp

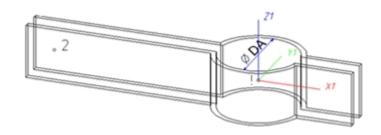

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Fitting point	Reference point placed on the centre line of a pipe during fitting	in origin (0,0,0)
2	Auxiliary point		X < 0, Y = 0, Z = 0

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes shown below, and that the predefined attribute assignment is entered.

Possibility 1:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
These parameters apply to pipes which	ch fit into the clamps		
Nominal diameter	N	NENNWEITE	
Outer diameter	DA	D_AUSSEN	
Additionally (only if the corresponding standard uses nominal diameters in inches):			
Nominal diameter (inches)	NI	N_INCH	
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for 1 1/2").			

Possibility 2:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute		
These parameters apply to pipes which fit into the clamps				
Outer diameter Largest possible outer diameter of pipe that is still suitable for pipe clamp	DA	D_AUSSEN		

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Outer diameter 2 Smallest possible outer diameter of pipe that is still suitable for pipe clamp	D2	D2_AUSSEN	
Nominal diameter	N	NENNWEITE	
Additionally (only if the corresponding standard uses nominal diameters in inches):			
Nominal diameter (inches)	NI	N_INCH	
Nominal diameters in inches need to be entered as decimal values as well (e.g. $1.5\mathrm{for}11/2$ ").			

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG (DESIGNATION)	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) <u>for HELiOS database only</u>
NORMBEZEICHNUNG (STANDARD_ DESIGNATION	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

For the insertion of a pipe clamp having these two outer diameter attributes the Also use Outer diameter 2 as search criterion for pipe clamps checkbox on the Part search tab of the Plant Engineering Settings dialogue must be active.

HiCAD Plant Engineering 129 / 158

Variant for Part Type: Vessels, Pumps, Other Components

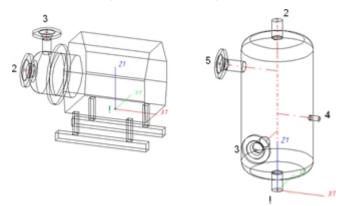

Named isolated points

Designation	Purpose	Description	Position in coordinate system
!	Connecting point or auxiliary point	Fitting point	in origin (0,0,0)
2, 3, 4 etc., unambiguous within the part	Connecting points or auxiliary points		arbitrary

Connecting points should preferably be created via the Component connection function, or (for various components) by the insertion of nozzles.

Each component connection (and the fitting point, if it is an auxiliary point) needs to be located in a plane belonging to the part. It needs however not be located within the surface boundary.

Example:



If the connecting point is located in the plane of the ring surface, the surface condition is fulfilled.

Caution: It would also be fulfilled if the point would be located in the same plane, but outside of the ring.

To assign an unambiguous orientation to a connection, a connecting point must not fulfil the surface condition for several surfaces at once.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that appropriate attributes such as HOEHE (HEIGHT), BREITE (WIDTH), LAENGE (LENGTH) etc.are assigned to the individual variables, enabling a distinguishing between various sub-types during part selection.


For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

AttributE	Description
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material+Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 131 / 158

Variant for Part Type: Nozzle

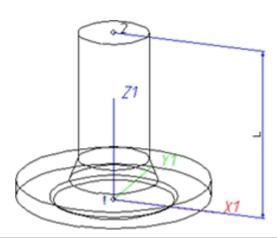

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Length of distance between points "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Nominal diameter, Connection "3" and "4"	N3	NENNWEITE3
Additionally (only if the correspond	ing standard uses nominal diameters	in inches):
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameter (inches), Connection "3" and "4"	NI3	N3_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be consid- necting sockets they refer to the piper.	ered for all connection types except for the connection types except for the connection types.	or flange connections. For con-
Outer diameter, Connection "!" and "2"	D	D_AUSSEN
Outer diameter, Connection "3" and "4"	D3	D3_AUSSEN
Wall thickness, Connection "!" and "2"	S	WANDDICKE
Wall thickness, Connection "3" and "4"	\$3	WANDDICKE3

If required, the attribute LAENGE need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

HiCAD Plant Engineering 133 / 158

Values must be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of part	
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only	
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.	
ANSCHLUSSART	Connection type for connection "!"	
ANSCHLUSSART2	Connection type for connection "2" (value always 10000)	
Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):.		

1 0001010 11		2000, IIV. (0011112011011_11112)
1000x	Butt-welded	Provide auxiliary part when fitting part
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket-welded, nipple	
5200x	Socket-welded, socket	

The last character (x) provides information about the meaning of the supplement:

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.


⁰=No supplement


^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

Variant for Part Type: Other Pipe Parts

Up to 4 connections are possible for this part type.

The connections "!" and "2" need to be located on the Z-axis. The position of further connections is arbitrary. However, connections "3" and "4" cannot process guidelines during part insertion. The creation of guidelines starting from connections "3" and "4" can only be performed subsequently. Therefore, you will only have the following fitting options:

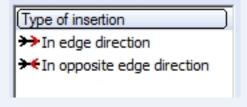

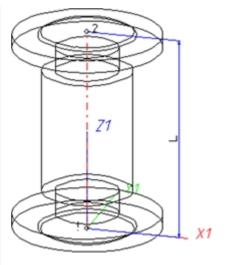

Example: Compensator with flanges

Position of connecting points and determination of insertion lengths for various connection types			
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	optional	arbitrary
4	Fiting point	optional	arbitrary

Variables names

Name	Description	Attribut (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

HiCAD Plant Engineering 135 / 158

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered.

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Additionally (only if the correspond	ing standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be consid necting sockets they refer to the pi	ered for all connection types except f	or flange connections. For con-
Outer diameter, Connection "!" and "2"	D	D_AUSSEN
Wall thickness, Connection "!" and "2"	S	WANDDICKE

If required, the attributes LAENGE needs to be assigned to the length variables. (see Variables names above).

As mentioned above, the part may have up to 4 connections. If a connection "4" exists, it needs to have the same properties (Nominal diameter, Outer diameter, Wall thickness, Connection type) as connection "3". For three connections, various properties can be preset:

Parameter	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!"	N	NENNWEITE
Nominal diameter, Connection "2"	N2	NENNWEITE2
Nominal diameter, Connection "3" [and "4"]	N3	NENNWEITE3
Nominal diameter (inches), Connection "!"	NI	N_INCH
Nominal diameter (inches), Connection "2"	NI2	N2_INCH
Nominal diameter (inches), Connection "3" [and "4"]	NI3	N3_INCH
Outer diameter, Connection "!"	D	D_AUSSEN
Outer diameter, Connection "2"	D2	D2_AUSSEN
Outer diameter, Connection "3" [and "4"]	D3	D3_AUSSEN
Wall thickness, Connection"!"	S	WANDDICKE
Wall thickness, Connection "2"	S2	WANDDICKE2
Wall thickness, Connection "3" [and "4"]	S3	WANDDICKE3

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

HiCAD Plant Engineering 137 / 158

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Part type designation
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for all connections
ANSCHLUSSART2	Connection type for connection "2", if different from that for connection "1"
ANSCHLUSSART3	Connection type for connection "3" [and "4"], if different from that for connection "2" n

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1000x	Butt-welded	Provide auxiliary part when fitting part
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard spe-
2100x	Flange with groove connection	cified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of
2200x	Flange with notch connection	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	EN 1092-1/11/A/PN 40 is the standard designation with which the flange is to be entered into the database.
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, socket	
5100x	Socket-welded, nipple	

The last character (x) provides information about the meaning of the supplement:

Socket-welded, socket

5200x

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

⁰=No supplement


^{2 =} The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 139 / 158

Variant for Part Type: T-Piece

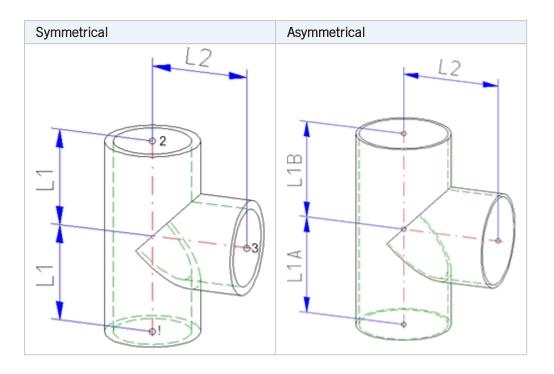

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L1	Half the length of the distance between points "!" and "2"	LAENGE1
L2	Distance of point "3" from straight line through "!" and "2"	LAENGE3
L1A	Distance between the point "!" and the perpendicular from the point "3" onto the distance between the points "!" and "2"	
L1B	Distance between the point "2" and the perpendicular from the point "3" onto the distance between the points "!" and "2"	

For asymmetrical T-pieces the following applies:

If the variable L1 exists in the variant, the insertion length will be the double amount of L1. Otherwise, the insertion length will be the sum of L1A and L1B.

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

For asymmetrical T-pieces the additional variable L3 is available. If the variable L3 does not exist in the variant, the insertion length will be the double amount of L1. If L3 exists, the insertion length will be the sum of L1 and L2. This selection of designations corresponds to the length definitions of branchings.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

and that the predefined attribute assig		
Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Nominal diameter, Connection "3"	N3	NENNWEITE3
Additionally (only if the correspond	ling standard uses nominal diameters	s in inches):
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameter (inches), Connection "3"	NI3	N3_INCH
Nominal diameters in inches need to	be entered as decimal values as well	(e.g. 1.5 for 1 1/2").
These parameters are to be considered necting sockets they refer to the pi	lered for all connection types except pe to be inserted:	for flange connections. For con-
Outer diameter, Connection"!" and "2"	D	D_AUSSEN

HiCAD Plant Engineering 141 / 158

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Outer diameter, Connection "3"	D3	D3_AUSSEN
Wall thickness, Connection "!" and "2"	S	WANDDICKE
Wall thickness, Connection "3"	S3	WANDDICKE3

If required, the attributes LAENGE1 and LAENGE3 need to be assigned to the length variables. (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description	
BENENNUNG	Designation of the part	
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only	
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.	
ANSCHLUSSART	Connection type for connections "!" and "2"	
ANSCHLUSSART3	Connection type for connection "3"	
Possible values of the attribute ANSCHLU	JSSART (CONNECTION_TYPE):	
1000x Butt-welded	Provide auxiliary part when fitting part If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for	

1000	Ox Butt-welded	Provide auxiliary part when fitting part
2000	Ox Flange connection	If appropriately preset in the ANSCHL a connection, the part will provide and
2100	Ox Flange with groove connection	cified in the attribute for the connection a flange connection and the correspon
2200	Ox Flange with notch connection	the ANSCHLUSSART (CONNECTION 20002 1 5100010 EN 1092-1/11/A/P
2040	Ox Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.	entered into the database.
3100	Ox Screwed, nipple	

d connect an auxiliary part of the standard spen when being fitted. For example, if the part has nding counter-flange is required, the content of N TYPE) attribute could look as follows:

PN 40

dard designation with which the flange is to be

The last character (x) provides information about the meaning of the supplement:

0=No supplement

3200x

4100x

4200x

5100x 5200x Screwed, socket

Plugged, nipple

Plugged, socket

Socket-welded, nipple

Socket-welded, socket

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_ INCH and N3. The usual character strings for indication of the diameter in inches (e.g. 11/2" instead of 1.5) will be auto-generated in the database for the attributes NPS INCH, NPS2 INCH und NPS3 INCH.

HiCAD Plant Engineering 143 / 158

Variant for Part Type: 4-Way Valve

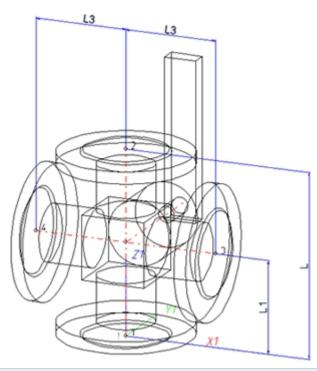

Position of connecting points and determination of insertion lengths for various connection types				
Connection for butt welding	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection	
a 2	a	a 2	a 2	
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0
3	Connecting point	on branch	X > 0, Y = 0, Z > 0
4	Connecting point	on branch	X < 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Length of distance between points "!" and "2"	LAENGE
L1	Length of distance between points "!" and the intersection point of centre lines	LAENGE1
L3	Half the length of the distance between points "3" und "4"	LAENGE3

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter Il dimensions must be specified in milmetres; xception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Nominal diameter, Connection "!" nd "2"	N	NENNWEITE	
Nominal diameter, Connection 3" and "4"	N3	NENNWEITE3	
dditionally (only if the corresponding	ng standard uses nominal diameters	in inches):	
Nominal diameter (inches), Conection "!" and "2"	NI	N_INCH	
Nominal diameter (inches), Conection "3" and "4"	NI3	N3_INCH	
lominal diameters in inches need to	be entered as decimal values as well (e.g. 1.5 for 1 1/2").		
These parameters are to be considered for all connection types except for flange connections. For connecting sockets they refer to the pipe to be inserted:			
Outer diameter, Connection "!" nd "2"	D	D_AUSSEN	
Outer diameter, Connection "3" nd "4"	D3	D3_AUSSEN	
Vall thickness, Connection "!" nd "2"	S	WANDDICKE	
Vall thickness, Connection "3" nd "4"	S3	WANDDICKE3	
Nominal diameter, Connection 3" and "4" Additionally (only if the corresponding and "1" and "2" Nominal diameter (inches), Connection "1" and "4" Nominal diameter (inches), Connection "3" and "4" Nominal diameters in inches need to be considered in the pipe of the properties of of the propert	ng standard uses nominal diameters NI NI3 be entered as decimal values as well (red for all connection types except for to be inserted: D D3 S	in inches): N_INCH N3_INCH (e.g. 1.5 for 1 1/2"). or flange connections. For cor D_AUSSEN D3_AUSSEN WANDDICKE	

If required, the attributes LAENGE, LAENGE1 and LAENGE3 need to be assigned to the length variables (see Variables names above).

HiCAD Plant Engineering 145 / 158

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART (CONNECTION_TYPE)	Connection type for Connection "!", "2", "3" and "4"

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):.

1000x	Butt-welded
2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a sub-part and has no own article master attached to this connection.
3100x	Screwed, nipple
3200x	Screwed, socket
4100x	Plugged, nipple

Plugged, socket

Socket-welded, nipple

Socket-welded, socket

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

EN~1092--1/11/A/PN~40 is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

0=No supplement

4200x

5100x 5200x

 $\mathbf{2}$ = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.


Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_INCH, N2_INCH and N3_. The usual character strings for indication of the diameter in inches (e.g. 1 1/2" instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

Variant for Part Type: Seal

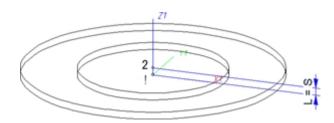

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Description	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute
Nominal diameter, Connection "!" and "2"	N	NENNWEITE
Seal thickness (values same as for Variable L)	S	DICKE
Additionally (only if the corresponding standard uses nominal diameters in inches):		
Nominal diameter (inches), Connection "!" and "2"	NI	N_INCH
Nominal diameters in inches need to be entered as decimal values as well (e.g. 1.5 for $1\ 1/2$ ").		

If required, the attribute LAENGE (LENGTH) needs to be assigned to the length variables (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

HiCAD Plant Engineering 147 / 158

Attribute	Designation
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry is mandatory, even if the part corresponds to no standard.
ANSCHLUSSART	Connection type for connection "!" and "2" (Value= 20000 for Flange connection)

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

2000x	Flange connection
2100x	Flange with groove connection
2200x	Flange with notch connection
2050x	Flange connection of a seal that is exclusively intended for the pushed in end of a push-in pipe. The effect of this value is that a loose flange, together with the push-in pipe, will be connected to the seal. The pushed in of the push-in pipe must have the connection type $10xxx$. Flange connection.

Provide auxiliary part when fitting part

If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute for a connection, the part will provide and connect an auxiliary part of the standard specified in the attribute for the connection when being fitted. For example, if the part has a flange connection and the corresponding counter-flange is required, the content of the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows:

20002 1 5100010 EN 1092-1/11/A/PN 40

 ${\bf EN~1092\text{-}1/11/A/PN~40}$ is the standard designation with which the flange is to be entered into the database.

The last character (x) provides information about the meaning of the supplement:

0 = No supplement

2 = The supplement consists of connection number, part type, ID, and standard of the part to be connected

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.

Pressure ranges

In previous versions the nominal pressure was of no significance for the search of matching sealing gaskets. To take pressures ranges into account, the attribute **DRUCK_MIN** (Minimum pressure) is now available.

When you now search a sealing gasket for a flange, the following, additional search condition will be generated from the nominal pressure **PN** of the flange:

(MIN_DRUCK ist unbelegt oder MIN_DRUCK <= PN) und (DRUCK ist unbelegt oder DRUCK >= PN) (Minimum pressure not specified or Minimum pressure <=PN) and (Minimum pressure not specified or Minimum pressure >=PN)

Sealing gaskets without pressure specifications will thus be handled as if they were suitable for any nominal pressure.

The standard parts that are by default supplied with HiCAD do not include sealing gaskets with a defined pressure range. Therefore, this new feature is currently only relevant for gaskets that have been created by the user. Accordingly, the attribute DRUCK_MIN (Min. pressure) will not be available in the search masks that are by default supplied with HELiOS. If desired, you can add this attribute with the HELiOS Mask Editor.

If you prepare the database for Plant Engineering by clicking the corresponding button in DBPlantDataImport.exe, the attribute **DRUCK_MIN** will be entered, with the designation **Minimum pressure**, into the database.

An example from practice:

If you do not want gaskets with an own article number for each pressure level to be created, you can avoid this by means of the **DRUCK_MIN** attribute.

Furthermore, you have now the option to narrow search results for sealing gaskets by specifying a value for the attribute **DRUCK** (Pressure), e.g. by including only gaskets with a defined pressure in your pipe class.




Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_{INCH} , $N2_{INCH}$ and $N3_{INCH}$. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_INCH, NPS2_INCH und NPS3_INCH.

HiCAD Plant Engineering 149 / 158

Variant for Part Type: Fastener

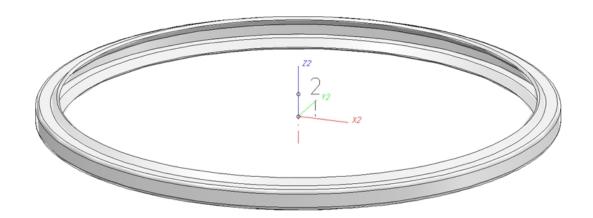

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	In origin (0,0,0)
2	Auxiliary point		X = 0, Y = 0, Z > 0

The part has no insertion length. When the part is inserted, it will be placed with its fitting point onto a connection of the target part. Connecting point 2 will only be used for a correct alignment.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter	Variable	Assigned attribute
All dimensions must be specified in millimetre Exception: Nominal diameters in inches	es; (suggestion)	
Nominal diameter for which the fastener is intended	N	NENNWEITE
Additionally (only if the corresponding standard uses n	ominal diameters in inc	ches):
Nominal diameter in inches (as decimal number) for which the fastener is intended	ch NI	N_INCH
Nominal diameter in inches needs to be entered as a decimal number as well (e.g. 1.5 for 1 1/2").		
These additional values make sense if the above attribu	utes should not be suffi	cient as search criteria:
Outer diameter for which the fastener is intended	D	D_AUSSEN
Wall thickness for which the fasteners is intended	S	WANDDICKE

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Designation
BENENNUNG	Designation of the part
COMPONENT_TYPE	Part type (always= Semi-finished product+Plant Engineering) only if HELiOS database is used
NORMBEZEICHNUNG	Standard designation of the part (identical for all sub-types!) An entry will even be required if the part corresponds to no standard.
ANSCHLUSSART	Connection type for which the fastener is intended

Possible values of the attribute ANSCHLUSSART (CONNECTION_TYPE):

1000x	Butt-welded	Ple
2000x	Flange connection	The cor
2100x	Flange with groove connection	the abl
2200x	Flange with notch connection	
2040x	Flange connection of a part that is not a flange itself. The part has a loose flange that is modelled as a subpart and has no own article master attached to this connection.	
3100x	Screwed, nipple	
3200x	Screwed, socket	
4100x	Plugged, nipple	
4200x	Plugged, sleeve	
5100x	Sleeve-welded, nipple	

Please note:

The option to specify, via the attribute ANSCHLUSSART, a connected part that will automatically be inserted together with the part (if the corresponding option has been set) is not available here.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



5200x


Sleeve-welded, sleeve

Handling of nominal diameters in inches in the HELiOS database:

During part data synchronization, nominal diameters in inches will be taken over to the attributes N_{NCH} , $N2_{NCH}$ and $N3_{NCH}$. The usual character strings for indication of the diameter in inches (e.g. $1\ 1/2$ " instead of 1.5) will be auto-generated in the database for the attributes NPS_{NCH} , NPS_{NCH} und $NPS3_{NCH}$.

HiCAD Plant Engineering 151 / 158

Variant fpr Part Type: Saddle Connection / Elbolet

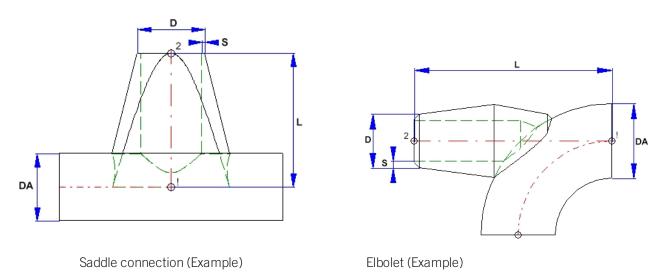

D=Outer diameter of the nozzle, DA=Outer diameter of the part to which the connection is made, L=Length, S=Wall thickness

Please note that the variable DA (Outer diameter) will be modified upon insertion. It will be applied to the outer diameter of the pipe to which the connection is made. This allows the calculation of the part geometry to match the respective fitting situation. Please check whether the geometry of the constructed saddle connection correctly adjust itself to a modified DA value.

Position of connecting poin	ts and determination of ir	nsertion lengths for various o	onnection types
Connection for butt weld- ing	Flange connection	Connecting nipple for screwed, plugged or socket-welded connection	Connecting socket for screwed, plugged or socket-welded connection
a 2	a	a 2	a 2
a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)	a = Insertion length dimension (e.g. L, L1 etc.)

Named isolated points

Designation	Purpose	Comment	Position in coordinate system
!	Connecting point	Fitting point	in origin (0,0,0)
2	Connecting point		X = 0, Y = 0, Z > 0

Variables names

Name	Designation	Attribute (optional)
L	Distance between point "!" and "2"	LAENGE

If the variables names given in the **Name** column are used, you do not need to assign any attributes to them via the Variant Editor. If different variables are required, you need to assign the attributes given in the **Attribute** column.

VAA file

Use the Variant Editor to enter the suitable part type into the VAA file.

Then, use the Variant Editor to expand the VAA file in such a way that it contains values for the sizes specified here, and that the predefined attribute assignment is entered:

Parameter All dimensions must be specified in millimetres; Exception: Nominal diameters in inches	Variable (suggestion)	Assigned attribute	
Nominal diameter, Connection "!"and "2"	N	NENNWEITE	
Length	L	LAENGE	
Additionally (only if the corresponding standard us	es nominal diameters	in inches):	
Nominal diameter (inches), Connection "!" and "2" NI N_INCH			
As only decimal values are saved to the VAA file as parentered as decimal values as well (e.g. $1.5\mathrm{for}11/2^{\prime\prime}$)		al diameters in inches need to be	
	ection types except fo		
entered as decimal values as well (e.g. 1.5 for 1 1/2") These parameters are to be considered for all conr	ection types except fo		
These parameters are to be considered for all connecting sockets they refer to the pipe to be inserted. Outer diameter of the part to which the connection is made. This allows a suitable adjustment of the	ection types except fo	r flange connections. For con-	

If required, the attribute LAENGE needs to be assigned to the length variables (see Variables names above).

For variant synchronization you also need to enter the values for the attributes which are to apply to all sub-types of the variant.

Values must be entered for at least the following attributes:

Attribute	Description
BENENNUNG	Designation of part
COMPONENT_TYPE	Part type (always = Semi-finished material + Plant Engineering) for HELiOS database only
NORMBEZEICHNUNG	Standard designation of the part. An entry is mandatory, even if the part corresponds to no standard.

HiCAD Plant Engineering 153 / 158

Attribute		Description		
ANSCHLUSSART Connection		Connection type for Connection "!"(and "2")	type for Connection "!"(and "2")	
ANSCHLUSSART2 value to the lift different value of the		If the same connection type is required at both part ends it will suffice to assign a value to the attribute ANSCHLUSSART.		
		f different connection types are required at the part ends you need to assign Value of the connection type for Connection 1 to the attribute ANSCHLUS and the connection type for Connection 2 to the attribute ANSCHLUSSART2	SART	
	values of the attrib CTION_TYPE2): Butt-welded	tes ANSCHLUSSART (CONNECTION_TYPE) and ANSCHLUSSART2 Provide auxiliary part when fitting part		
2000x	Flange connection	If appropriately preset in the ANSCHLUSSART (CONNECTION_TYPE) attribute a connection, the part will provide and connect an auxiliary part of the standard s		
2100x	Flange with groove o	cified in the attribute for the connection when being fitted. For example, if the part a flange connection and the corresponding counter-flange is required, the conter		
2200x	Flange with notch co	the ANSCHLUSSART (CONNECTION_TYPE) attribute could look as follows: 20002 1 5100010 EN 1092-1/11/A/PN 40		
2040x	Flange connection of is not a flange itself. a loose flange that is	entered into the database.) be	

The last character (x) provides information about the meaning of the supplement:

a sub-part and has no own article master attached to this con-

nection

Screwed, nipple

Screwed, socket

Plugged, nipple

Plugged, socket

Socket-welded, nipple Socket-welded, socket

0=No supplement

3100x

3200x

4100x

4200x

5100x

5200x

The prefixed connection number indicates the connection with which the auxiliary part is to be attached to the current connection.

Please also read the information given in the paragraphs Connection type ID with priority information and Connection type ID - List of part standards.



Important:


- When working with the HELiOS database, please pay attention to the correct classification matching the part type.
- During variant synchronization the **Nominal diameters in inches** will initially only be taken over into the attribute N_INCH in the form of decimal numbers. The usual character strings for the specification of the nominal diameter in inches (e.g. 1 1/2" instead of 1.5) can be subsequently generated in the HELiOS database for the attribute NPS_INCH. For this purpose the HiCAD macro ANLDB_ZOLLATTRIGEN.MAC in the \HICAD\MAKROANL folder is used.

 $[\]mathbf{2}$ = The supplement consists of connection number, part type, ID, and standard of the part to be connected

Rules for the Creation of Symbolic Representations

Symbolic representations are required for parts or part variants that are used for pipelines of which you want to generate isometries. You use the **Symbol Editor** to draw such symbolic representations.

Below please find the example of a T-piece:

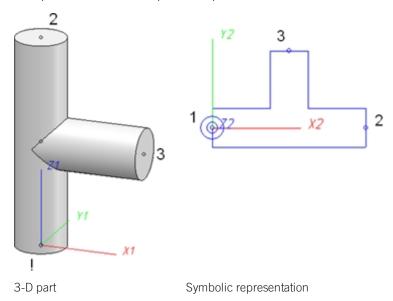


1. Position in the coordinate system

The symbolic representation is drawn in the **Symbol Editor** as a 2-D part in the XY-plane. The Z-axis in the 3-D part corresponds to the X-axis in the symbolic 2-D representation. The 3-D X-axis corresponds to the 2-D Y-axis.

2. Named isolated points:

The symbolic representation needs to contain (just as the 3-D part) named isolated points indicating the positions of connections or auxiliary points. The point "1" in the symbolic representation is located in the origin of the coordinate system and corresponds to the point "!" in the 3-D part. Points "2" and "3" correspond to the same-named points in the 3-D part.

There are only two parts that require a point "4" in their symbolic representations, namely **Branch** and **Y-piece** (the 4-way valve contains no point "4").

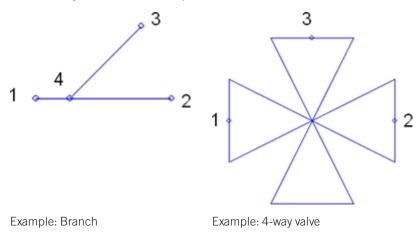

HiCAD Plant Engineering 155 / 158

Legal notes

 $\ @$ 2021 ISD $\ @$ Software und Systeme GmbH. All rights reserved.

This User Guide and the software described herein are provided in conjunction with a license and may only be used or copied in accordance with the terms of the license. The contents of this User Guide solely serve the purpose of information; it may be modified without prior notice and may not be regarded as binding for the ISD Software und Systeme GmbH. The ISD Software und Systeme GmbH does not assume any responsibility for the correctness or accuracy of the information provided in this document. No part of this document may be reproduced, saved to databases or transferred in any other form without prior written permission by the ISD Software und Systeme GmbH, unless expressly allowed by virtue of the license agreement.

All mentioned products are trademarks or registered trademarks of their respective manufacturers and producers.

HiCAD Plant Engineering 157 / 158





ISD Software und Systeme GmbH

Hauert 4 44227 Dortmund Germany Tel. +49 (0)231 9793-0 info@isdgroup.de

ISD Berlin

Paradiesstraße 208a 12526 Berlin Germany Tel. +49 (0)30 634178-0 berlin@isdgroup.de

ISD Hamburg

Strawinskystraße 2 25337 Elmshorn Germany Tel. +49 (0)4121 740980 hamburg@isdgroup.de

ISD Hannover

Hamburger Allee 24 30161 Hanover Germany Tel. +49 (0)511 616803-40 hannover@isdgroup.de

ISD Nürnberg

Nordostpark 7 90411 Nuremberg Germany Tel. +49 (0)911 95173-0 nuernberg@isdgroup.de

ISD Ulm

89073 Ulm

Germany Tel. +49 (0)731 96855-0 ulm@isdgroup.de

Wilhelmstraße 25

ISD Austria GmbH

Hafenstraße 47-51 4020 Linz Austria Tel. +43 (0)732 21 04 22-0 info@isdgroup.at

ISD Benelux b.v.

Het Zuiderkruis 33 5215 MV 's-Hertogenbosch The Netherlands Tel. +31 (0)73 6153-888 info@isdgroup.nl

ISD Benelux b.v.

Grote Voort 293A 8041 BL Zwolle The Netherlands Tel. +31 (0)73 6153-888 info@isdgroup.nl

ISD Schweiz AG

Rosenweg 2 4500 Solothurn Switzerland Tel. +41 (0)32 624 13-40 info@isdgroup.ch

ISD Group France SAS

10 -12 Boulevard Vivier Merle 69393 Lyon cedex 03 France lyon@isdgroup.fr

ISD Group USA Inc.

721 Jetton Street Two Harbour Place NC 28036 Davidson USA Tel. +1 (0)770 349 6321 usa@isdgroup.com

ISD Group USA Inc.

5126 South Royal Atlanta Drive GA 30084 Tucker USA Tel. +1 (0)770 349 6321 usa@isdgroup.com

www.isdgroup.com

HiCAD_2601

This document is generated automatically.

© 2021 ISD Software und Systeme GmbH